


**No Further Accelerated  
Action Justification  
for the Sanitary Sewer System,  
PAC 000-500**

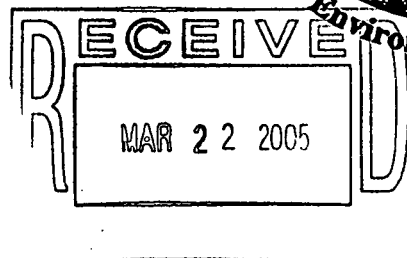

**March 2005**

**ADMIN RECORD**

**IA-A-002567**

**No Further Accelerated  
Action Justification  
for the Sanitary Sewer System,  
PAC 000-500**

Approval received from the Colorado Department of Public Health and Environment

March 21, 2005

Approval letter contained in the Administrative Record.

## **TABLE OF CONTENTS**

PAC REFERENCE NUMBER 000-500 .....	1
Background Information.....	1
Discharges to the Sanitary Sewer System .....	3
Releases from the Sanitary Sewer System .....	5
Sanitary Sewer System Closure.....	7
Waste Sampling and Analysis .....	8

## **LIST OF TABLES**

Table 1 Sanitary Sewer Line Summary in 2004 .....	3
Table 2 Non-Sanitary Discharges to the Sanitary Sewer System .....	4
Table 3 Closure Summary for the Sanitary Sewer System .....	6
Table 4 Sanitary Sewer Waste Characterization Data Summary.....	8

## **LIST OF FIGURES**

Figure 1 PAC 000-500 Sanitary Sewer Systems Location Map.....	13
Figure 2 Sanitary Sewer System at Closure as of February 24, 2005.....	14
Figure 3 Sanitary Sewer System Surface Soil and Waste Sample Results.....	15
Figure 4 Best Management Practices at Manholes .....	16
Figure 5 Contaminant Pathway to Surface Water Disruption .....	17

## **APPENDICES AND ATTACHMENTS**

- Attachment 1 Technical Memorandum Closure Strategy for the Rocky Flats  
Environmental Technology Site - Sanitary Sewer System
- Attachment 2 Regulatory Contact Records

**NO FURTHER ACCELERATED ACTION JUSTIFICATION  
FOR THE SANITARY SEWER SYSTEM  
PAC REFERENCE NUMBER: 000-500**

IHSS Number: Not Applicable

Operable Unit: Industrial Area

IHSS Group: 000-3

Unit Name: Sanitary Sewer System

Approximate Location: Not Applicable

Date(s) of Operation or Occurrence

1952 - 2004

Description of Operation or Occurrence

**Background Information**

The Rocky Flats Environmental Technology Site (RFETS) sanitary sewer system was used for transport, storage, and treatment of sanitary waste since RFETS began operations in 1952. Figure 1 shows the sanitary sewer system as it was depicted in the Historical Release Report (HRR) (DOE 1992). Various drains, sinks, sumps, and latrines located in RFETS buildings discharged to central collection lines which transported the waste to the Sanitary Sewage Treatment Plant (Building 995). RFETS wastes incompatible with sanitary sewage treatment were designated process wastes and were handled in a separate system from sanitary wastes (Potential Area of Concern [PAC] 000-121, Original Process Waste Lines [OPWL]). In each RFETS building that generated process waste, waste discharge points (drains, sinks, sumps, and so forth) were designated as either sanitary waste or process waste receptacles, and were plumbed separately into the appropriate waste system. In some Plant facilities, wastes were or had historically been, collected and temporarily stored in tanks plumbed into both systems, and then transferred to the appropriate system based on analytical results (DOE 1992).

Historically, some stormwater sources, such as roof drains, were connected to the sanitary sewer system. These were previously disconnected and there were no known cross-connections between the storm drain and sanitary sewer system. In addition, cooling tower sumps were generally pumped into the sanitary sewer system to dispose of cooling tower blowdown water. These were disconnected as the cooling towers were decommissioned (DOE 2004a).

Closure of the sanitary sewer system is nearing completion. Closure activities have been conducted as described in the Technical Memorandum – Closure Strategy for the Rocky Flats Environmental Technology Site Sanitary Sewer System (DOE 2004a).

Prior to closure, the estimated total length of the sanitary sewer lines was approximately 67,000 feet including active and abandoned lines. The diameter of the lines ranged from 3 to 12 inches with approximately 30,000 feet of 6-inch and larger lines and approximately 11,500 feet of 4-inch lines. The lines included vitrified clay pipe (VCP), as well as polyvinyl chloride (PVC) pipe, cast iron, and ductile iron pipe. PVC lines were installed in 1984 or later. In 1985, portions of the system were rehabilitated to reduce infiltration and leakage. Figure 2 depicts the sanitary sewer system and its components in 2004 (DOE 2004a).

The sanitary sewer collection system flowed by gravity from west to east across the Industrial Area (IA). However, some facilities, such as the Building 881 and Building 771 clusters, also had lift stations to pump sewage where gravity flow was not possible. Two sections of the sanitary sewer system existed: the north section collected flow from the Plant area formerly located within the Protected Area (PA) and also the 371 trailers, B116, and T117A; and the south section collected flow from the rest of the Plant exterior to the PA. The two sections joined at Building 990 (DOE 2004a).

From Building 990, wastewater flowed into one of three 110,000-gallon influent storage tanks at the Waste Water Treatment Facility (WWTF) allowing inflow to be collected while contents of another tank holding the previous day's flow was processed. The Site's wastewater treatment plant was an activated sludge treatment facility with a design capacity of 0.5 million gallons per day (MGD). In 2003, normal flows were approximately 0.16 MGD. The flow rate continued to decline until the treatment plant was taken out of service in October 2004 (DOE 2004a).

The lengths of various main sewer lines types were calculated based on Figure 2 and are presented in Table 1. The lengths presented are only for the main lines. Numerous smaller lines and laterals are associated with the buildings and were not included in this estimate. As shown in Table 1, 57 percent of the sewer system was active, and 43 percent had been abandoned prior to closure activities. Of the abandoned lines, approximately three fifths of them had already been abandoned prior to 1990. Many of these abandoned lines are believed to have been flushed, plugged, or removed. The more recent abandoned lines and the active lines in 2004 were flushed and plugged as part of the closure activities. Only a small fraction of the lines could not be located in the field (DOE 2004a).

**Table 1 Sanitary Sewer Line Summary as of 2004**

Component Lines	Length (feet)	Length (miles)	Percentage of Total Lines
<b>Current Sanitary Sewer Lines</b> All lines flushed and plugged at completion of closure	37,039	7.01	57%
<b>Previously Abandoned Lines</b>	27,998	5.30	43%
Abandoned Lines, Flushed and Plugged at Completion of Closure	10,809	2.05	17%
Lines Abandoned Prior to 1990	15,520	2.94	24%
Abandoned Lines, Not Located	1,072	0.20	2%
<b>Total Lines</b>	<b>65,037</b>	<b>12.32</b>	<b>100%</b>

Manhole inspections and photographs indicated that sanitary sewer lines were generally deeper than 3 feet below grade with the exception of the lines in the 130 trailer complex on the western side of the Site. Lines associated with buildings were generally shallower than three feet below grade because the system relies on gravity flow and shallower lines were required for flow from the buildings into the main lines (DOE 2004a).

#### **Discharges to the Sanitary Sewer System**

In the past, some nondomestic wastes were discharged into the sanitary sewer system. These discharges changed over time in response to internal guidelines and to State and federal regulations. Most of the potential contaminants discharged to the sanitary sewer system were derived from laundry waste. A 1967 survey indicated that of the average daily flow of 250,000 gallons, 21,000 gallons were laundry waste. However, a 1973 investigation of plutonium releases to the sanitary sewer system indicated that 88 percent of the plutonium in the sanitary sewer system at that time originated from the numerous laundries on Site. This primary source of contaminated discharges was eliminated when potentially contaminated laundry began being laundered off site in 1996. There was the potential for liquids to be dumped into the sanitary sewer by employees; however, this was not expected to be significant (DOE 2004a).

Table 2 summarizes information compiled on the currently known nonsanitary waste streams discharged into the sanitary sewer system through 1991. A few other nondocumented, nonsanitary releases to the system may also have occurred during this timeframe. For example, information exists that process waste backed up and caused a toilet in B701 to overflow (DOE 2004a).

Excluded from Table 2 are discharges of compounds not anticipated to be contaminants of concern, such as acids, dyes, unneutralized demineralization waste from the steam plant, ethylene glycol, and oil. A complete listing is found in the HRR (DOE 1992).

**Table 2 Non-Sanitary Discharges to the Sanitary Sewer System**

Waste Type	Description
Lab wastes	8/1953 & 4/1965 - Building 123 laboratory waste had high nitrates and unspecified radioactivity from urinalysis specimens. Unknown - Building 331 Old Lab Area had unspecified radioactive contamination around footing drains plumbed into sanitary sewer.
Laundry waste	1953 - Unknown Building 442 laundry wastewater discharged with varying radioactivity levels. September 1955 - 2,700 gallons of laundry waste discharged with alpha radioactivity exceeding 8,500 disintegrations/minute/liter (d/m/L) while leaks in Building 881 process waste line were repaired. 1986 - Building 444 elevator shaft sump and employee wash facilities are plumbed into sewer; small amounts of uranium oxide and beryllium potentially entered sanitary sewer. 1953 - Unknown Building 771 laundry waste exceeding the radioactivity limit for direct discharge to Walnut Creek is diluted with sanitary sewer system effluent to meet discharge limits. Building 881 process waste and laundry waste discharged to sanitary sewer. 1952-53 - Discharge limit is 10,000 d/m/L. 1954 discharge limit is 8,500 d/m/L. 1956 - Discharge limit suspended for indefinite period. 1986 - Document states that 2 restrooms in Building 883 are in use where workers do not have to clean up prior to use.
Hexavalent chromium	Mid-1962 - Several discharges of oil and hexavalent chromium waste. 6/26/63 - Unknown amount of hexavalent-chromium solution discharged. 5 parts per millions (ppm) hexavalent chromium at WWTF settling tank; 0.6 ppm at effluent. 12/12/63 - Unknown quantity of hexavalent chromium solution discharged to the sanitary sewer; 20 ppm was detected at settling tank, 0.18 ppm at effluent. 2/1989 - Chromic acid stored in Building 444 overflowed tanks and a containment berm and entered the building's foundation drains. The spill collected in a sump that automatically transferred to the sanitary sewer system with an estimated 30 pounds of chromium released to the sanitary sewer system. After the chromic acid release, Building 444 foundation drains were plumbed to process waste system.
Process waste	11/1964 - Releases to sanitary sewer occurred because of leaks in process waste lines from Buildings 441, 444, 881 and 883. 1974 - A document states that radioactive waste from Building 779 was pumped to sanitary sewer if it does not exceed unspecified discharge limits. 1978 - A document states that all drains in the Building 705 research facility drained to the sanitary sewer system. Uranium, beryllium, chromium and acids were used at this location. 1978 - A building 881 process waste sink was found to be plumbed into sanitary sewer. 1979 - A document states that unspecified chemicals from Building 559 were disposed of into sanitary drain. 1966 - Documents allow up to 500 milliliters of unspecified acids, bases, and solvents that can be discharged into sanitary sewer in Building 991.
Paint	9/11/70 - Silver paint used in Building 444 poured down unspecified drain and cleaned up. 1980 - Unspecified type and amount of paint released from Building 374 into sanitary sewer. Spill was controlled without reportedly causing environmental impact. 1990 - Building 374 discharged paint containing volatile organic compounds to the sanitary sewer.
Radioactive iodine	7/24/79 - Unknown amount of iodine-131 was released to the sanitary system as a result of an employee medical treatment. Source (building) of release unknown. 8/09/79 - Unknown amount of iodine-131 was released to the sanitary system as a result of an employee medical treatment. Source (building) of release unknown.
Tritium	4/73 - 5/73 - An estimated 50 - 100 curies of tritium were inadvertently released from Building 779 to the sanitary sewer system. One release contained an estimated six curies of tritium in 7,800 gallons of waste, and a second release contained an estimated 44 curies in 8,000 gallons of waste. 8/17/79 - 2,000 picoCuries per liter (pCi/L) were detected in effluent. Source was the steam condensate from Buildings 771, 776 and 779 that originated as Solar Evaporation Pond water. 1,000 gallons per hour were discharged until October 1979.
Scrubber solution	10/25/89 - Scrubber system in Building 444 overflowed. Effluent showed higher alpha and beta radioactivity than normal.

In 1991, Environmental Protection Agency (EPA) and Department of Energy (DOE) entered into the National Pollutant Discharge Elimination System (NPDES) Federal Facilities Compliance Agreement (FFCA) that implemented more controls over nonsanitary releases to the sanitary sewer system. Based on a review of spill records compiled since 1991, only a few spills are known that may have introduced potential contaminants of concern PCOCs into the sanitary sewer system. Most of the recent spills into the system were small, less than 100-gallon quantities of ethylene glycol or oils. The following discharges since 1991 are currently documented:

- 1994 – Seven gallons of photographic developer/fixer solution was released into the sanitary drain in B111. Floor area investigated in 2001 and determined to require no action.
- 1995 – Approximately 1 pound of mercury was spilled onto the floor in Building 443. Most of the mercury was believed to be caught in the floor drain P-trap and was retrieved.
- 1997 – Approximately 50 gallons of water with NALCO inhibitor, a possible chromium source, was discharged into the sanitary sewer from the B460 cooling tower.

### **Releases from the Sanitary Sewer System**

Treated effluent from Building 995 was discharged to Pond B-3 (PAC NE-142.7). Pond B-3 released through outlet works to Pond B-4 (PAC NE-142.8). Pond B-4 is released via outlet works to Pond B-5 (PAC NE-142.9), the terminal pond. Ponds B-1 (PAC NE-142.5) and B-2 (PAC NE-142.6) are isolated from the rest of the drainage, and were used for spill control. The PAC narratives in the 1992 HRR contain detailed historical information on discharges to the ponds. Sanitary system sludges containing low levels of radionuclides were historically disposed of on site in burial trenches (Trenches T-2 through T-11 [PACs NE-110, 900-109, and NE-111.1 through 111.8]). The 1992 HRR PAC narratives provide detailed information on these sludges.

The available information on other releases from the sanitary sewer system is summarized in other PAC narratives. PAC 700-144 (Sewer Line Break) and PAC 800-145 (Sanitary Waste Line) target releases from sanitary sewer lines that historically handled laundry water containing low concentrations of radionuclides. PAC 900-141 (Sludge Dispersal) addresses wind dispersion of radioactively contaminated sanitary system sludges from drying beds near Building 995. PAC 100-604 (T130 Complex Sewer Line Breaks) targets sanitary sewer line leaks in 1990 at the T130 office trailer complex west of the main RFETS production area (DOE 1992).

### **Physical/Chemical Description of Constituents Released**

Waste streams that have historically been discharged to the sanitary sewer system include laundry water, laboratory wastes, treated process waste effluents, photographic processing wastes, miscellaneous waste chemicals, and certain other waste streams according to the guidelines or regulations in existence at the particular time. Table 2 contains information regarding types and quantities of constituents released in these routine discharges (DOE 2004a).

### **Responses to Operation or Occurrence**

There was no specific response to the tritium release; however, because tritium has a short half life (12.5 years) and exists as hydrogen in water molecules, it quickly dissipates in the environment. The lack of tritium detections during Segment 4 Point of Compliance (POC) monitoring on Walnut Creek has resulted in its removal as an analyte of interest for the current monitoring program (DOE 2004b).



A Resource Conservation and Recovery Act (RCRA) Contingency Plan Implementation Report (CPIR) (89-001) was prepared and submitted for the chromic acid release of February 1989 (DOE 1992).

Closure of the sanitary sewer system was conducted in accordance with the Technical Memorandum – Closure Strategy for the Rocky Flats Environmental Technology Site Sanitary Sewer System (DOE 2004a). The Technical Memorandum provides the rationale for No Further Accelerated Action (NFAA) for the sanitary sewer system based on process knowledge and existing analytical data. This is discussed further in the next section. Given the NFAA rationale for the sanitary sewer system, the closure activities associated with the system are performed as a best management practice (BMP), or are part of the ongoing building Decontamination and Decommissioning (D&D) Program. Closure of the sanitary sewer system is summarized in Table 3. Specific releases to or from the sanitary sewer system that are designated PACs have either been closed with regulatory agency approval or will be closed (Table 3). The sanitary sewer closure is discussed further below.

**Table 3**  
**Closure Summary for the Sanitary Sewer System**

Sanitary Sewer Component	Closure Summary	Comments
Sewer Lines Beneath and Near Buildings, including Building 995	Lines flushed, lines removed within 3 feet of surface, and pipe ends (including pipes cut at depths greater than 3 feet) grouted that were not removed.	Closure in accordance with Facility Disposition Rocky Flats Cleanup Agreement (RFCA) Standard Operating Protocol (RSOP) (DOE 2004c)
Operating Lines, Manholes, and Lift Stations	1. Lines flushed, lines removed within 3 feet of surface, and pipe ends (including pipes cut at depths greater than 3 feet) grouted that were not removed. 2. Equipment in lift stations removed, manholes and lift station structures removed to 3 feet below final grade, pipe ends surveyed and plugged, and bottom of manholes and lift stations grouted. 3. Pipe bedding material disrupted at strategic locations.	A BMP in accordance with the Closure Strategy for the Sanitary Sewer System (DOE 2004a)
Abandoned Lines	Where known, lines within 3 feet of final ground surface removed, otherwise pipe ends surveyed and plugged.	A BMP in accordance with the Closure Strategy for the Sanitary Sewer System (DOE 2004a)
<b>Sanitary Sewer Components in other IHSSs</b>		
PAC 700-144 - Sewer Line Break	PAC 700-144 is in IHSS Group 700-3, which will be closed in Fiscal Year (FY)05	ER RSOP Notification #04-04 (DOE 2004d)
PAC 800-145 - Sanitary Waste Line	Closure approval in 1997	Closed through the OU 1 CAD/ROD (DOE 1997)
PAC 800-106 - Building 881 Outfall	Closure approval in 1997	Closed through the Operable Unit 1 (OU 1) CAD/ROD (DOE 1997)

Sanitary Sewer Component	Closure Summary	Comments
PAC 900-141 - Sludge Dispersal	No Further Action approval in 1999	Regulatory agency approval of 1997 Annual Update to HRR (EPA and CDPHE 1999)
PAC 100-604 - T130 Complex Sewer Line Breaks	No Further Action approval in 2002	PAC 100-604 was one of the PACs proposed for No Further Action (NFA) by the NFA Working Group, and approved by the regulatory agencies (EPA and CDPHE 2002)

### Sanitary Sewer System Closure

As shown in Table 3, the Site's sanitary sewer system, including the WWTF (Building 995 [B995]) cluster,<sup>1</sup> is being closed in accordance with the Facility Disposition Rocky Flats Cleanup Agreement (RFCA) Standard Operating Protocol (RSOP), Rev 1 (DOE 2004c), the Closure Strategy for the Sanitary Sewer System (DOE 2004a) (Attachment 1), and regulatory contact records (Attachment 2). Closure activities are nearly complete and will be documented in the project closeout reports for the B995 complex (see contact record dated January 13, 2005 [Attachment 2]). Closure of the sanitary sewer system included flushing all active and recently abandoned lines, removing all lines and structures within 3 feet of the surface, and plugging of all open lines.

Disruption of the utility trenches associated with the sanitary sewer system occurred at two places to further reduce east-west flow of groundwater through or around the sanitary sewer lines:

- 700 Area where the alluvium thins over an apparent bedrock high; and
- 800 Area north of the locations of B865/886 along Central Avenue.

Other areas disrupted as part of Plant closure that also act to reduce the flow of groundwater are:

- South of B881 where the sanitary sewer lift station was removed and backfilled.
- West of the WWTF where sanitary sewer lines were removed, the bedding material was disrupted, and the excavations were backfilled;
- North of B771 where the sanitary sewer lift station was abandoned in place and the area was backfilled, reducing the potential for groundwater to reach surface water; and
- South and west of B371 where a segment of the sanitary sewer line was removed during the land reconfiguration activities, significantly reducing the potential for groundwater collection in the sanitary sewer.

<sup>1</sup> The B995 cluster includes buildings 971, 972, 973, 974, T974A, 975, 976, 977, 988, 988A, and 990 as well as the influent and effluent storage tanks and the discharge line along the B-Series Ponds.

### Waste Sampling and Analysis

In consultation with the Colorado Department of Public Health and Environment (CDPHE), grab samples of solids within the sewer pipes were collected at locations shown on Figure 3, for the purpose of determining if additional BMPs were necessary beyond those generally prescribed by the Closure Strategy (DOE 2004a). These samples were analyzed for metals and radionuclides, and the analyte concentration data were compared to wildlife refuge worker (WRW) soil action levels (ALs) (DOE et al. 2003).<sup>2</sup> The data are summarized in Table 4. As shown on Figure 3, only two locations had waste solids where the analyte concentrations were above the WRW ALs; arsenic (26.0 milligrams per kilogram [mg/kg]) exceeded the WRW AL (22.2 mg/kg) at the Building 771 lift station; and chromium (1,300 mg/kg) and uranium-235 (9.8 picocuries per gram [pCi/g]) exceeded the WRW ALs of 268 mg/kg and 8 pCi/g, respectively, at the Building 881 lift station. Because there is no pathway to surface water at the B771 lift station, and the B881 lift station was removed, additional BMPs were not considered at these locations. WRW ALs were not exceeded at the one location (south of Building 881) where surface soil was sampled (Figure 3).

**Table 4**  
**Sanitary Sewer Waste Characterization Data Summary**

Analyte Group	Analyte	Total Number of Samples Analyzed	Detection Frequency	Average Conc.	Maximum Conc.	WRW AL	Unit
Metals	Aluminum	9	100%	11456	30000	228000	mg/kg
Metals	Antimony	9	67%	2.0	4	409	mg/kg
Metals	Arsenic	9	100%	7.7	26	22.2	mg/kg
Metals	Barium	9	100%	113	210	26400	mg/kg
Metals	Beryllium	9	89%	0.7	1.5	921	mg/kg
Metals	Cadmium	9	78%	4.6	12	962	mg/kg
Metals	Chromium	9	100%	232	1300	268	mg/kg
Metals	Cobalt	9	100%	11	26	1550	mg/kg
Metals	Copper	9	100%	284	770	40900	mg/kg
Metals	Iron	9	100%	68333	230000	307000	mg/kg
Metals	Lead	9	100%	138	500	1000	mg/kg
Metals	Lithium	9	89%	8.1	17	20400	mg/kg
Metals	Manganese	9	100%	328	870	3480	mg/kg
Metals	Mercury	9	100%	3.8	31	25200	mg/kg
Metals	Molybdenum	9	100%	9.2	32	5110	mg/kg
Metals	Nickel	9	100%	120	550	20400	mg/kg
Metals	Selenium	9	22%	1.9	2	5110	mg/kg
Metals	Silver	9	100%	25	160	5110	mg/kg
Metals	Strontium	9	100%	42	76	613000	mg/kg
Metals	Tin	9	89%	43	290	613000	mg/kg

<sup>2</sup> Although waste in the sewer lines is not soil, comparison was made to the WRW ALs because of the potential for the material to impact surface water.

Analyte Group	Analyte	Total Number of Samples Analyzed	Detection Frequency	Average Conc.	Maximum Conc.	WRW AL	Unit
Metals	Uranium, Total	9	78%	61	370	2750	mg/kg
Metals	Vanadium	9	100%	31	56	7150	mg/kg
Metals	Zinc	9	100%	976	3600	307000	mg/kg
Radionuclides	Americium-241	9	33%	0.7	1.06	76	pCi/g
Radionuclides	Plutonium-239/240	9	33%	4.0	6.042	50	pCi/g
Radionuclides	Uranium-234	9	78%	3.5	6.95	300	pCi/g
Radionuclides	Uranium-235	9	44%	2.6	9.814	8	pCi/g
Radionuclides	Uranium-238	9	78%	3.5	6.95	351	pCi/g

Note: Analytes shown are those that were detected and have a WRW AL.

### Fate of Constituents Released to Environment

PAC 000-500 has been assessed to render an NFAA determination. The sanitary sewer lines, including smaller lines, main lines, and abandoned lines, are not significant contaminant sources at RFETS for the following reasons (DOE 2004a):

- Sanitary sewer lines and components associated with buildings were removed to a depth of 3 feet below the final grade as stated in the Facility Disposition RSOP (DOE 2004c). These are predominately smaller lines and represent a large percent of the total sewer line length due to the number of lines beneath and around facilities. Also, some sewer lines were connected to administrative buildings or other nonprocess buildings and were never associated with processes that could contaminate the lines.
- The closure of operating lines, manholes, and lift stations, as well as the disruption of key utility trenches, has effectively disrupted contaminant pathways to surface water from the sanitary sewer (Figure 4).
- PACs associated with specific releases to or from the sanitary sewers either have been closed (PAC 800-145 - Sanitary Waste Line, PAC 800-106 - Building 881 Outfall), have an approved NFAA (PAC 900-141 - Sludge Dispersal, PAC 100-604 - T130 Complex Sewer Line Breaks), or will be addressed through closure of Individual Hazardous Substance Site (IHSS) Group 700-3 (PAC 700-144 - Sewer Line Break).
- The main contaminant source to the sanitary sewer system was laundry waste that was discontinued many years ago. The Building 442 laundry was one of the first laundries at the site and was known to have discharged wastewater into the sanitary sewer with potentially radioactive contamination (Table 1). Because it was active early in Plant history, the discharge levels were most likely the highest that occurred. During the accelerated action for IHSS Group 400-7 in 2002, 5 feet of a sewer line underneath the Building 442 slab was removed outside of the

building to more than 6 feet below grade, to the point where this cast iron pipe was joined to a 6-inch PVC pipe. Even though the joint consisted of a dilapidated rubber boot, no soil contamination was present. Solids in the line were sampled and analyzed, and the remaining line was plugged at both ends. Because some contaminated material in the pipe was left in place, Subsurface Soil Risk Screen (SSRS) was performed (DOE 2004c) as described in Attachment 5, Section 5.3 to RFCA (DOE et al. 2003). The screen indicated an accelerated action is not warranted.

- All of the major contaminant discharges to the sewer system happened prior to 1990 (Tables 1 and 2). There has not been a major incident since the February 1989 chromic acid spill. Significant quantities of sewage have likely been discharged through these lines since these incidents occurred. Much tighter controls over hazardous wastes, radionuclides, and other potential contaminants were implemented in the 1980s and 1990s at RFETS greatly reducing the number of spills that could have impacted the sewer system, as documented in the few incidents occurring in the 1990s. Other measures were also taken including an intensive effort to label all drains and an evaluation of lines to ensure they were separated from hazardous and radiological sources.
- High contaminant concentrations in sewer lines were not found except near buildings. At these locations, pipes were removed or pipelines were isolated.
- Jetting of the main lines eliminated significant solids within the lines. While no data were collected from the removed solids, the jetting equipment was not radiologically contaminated during the operations, indicating that significant levels of removable radioactivity are not present in the main system. Fixed contamination in the lines will not result in contamination release. As stated above, major contaminant discharges to the system no longer occur. Therefore, contamination of these lines after flushing is unlikely.
- Infiltration and inflow studies indicate water leaks into the sanitary sewer system, and exfiltration is minimal. Therefore, contamination in the soil along the sanitary sewer system is unlikely. This is due, in part, because most of the system operates under gravity flow rather than pressurized. Additionally, it is anticipated that even if the overall site water table rises after Site closure, grouting at manholes will further isolate the residual sanitary sewer lines, eliminating these as a pathway.
- In recent years, a number of modifications were made to prevent infiltration and, coincidentally, exfiltration of the sewer lines. Lines were slip-lined to seal joints and other areas that could potentially leak.
- Biosolids are similar to residual solids that may remain in the sanitary sewer lines. Because the largest lines were flushed, there may only be negligible amounts in these lines. In abandoned lines were not flushed, the amount could vary. However, biosolids data (DOE 2004c) indicate this material is not a risk to the environment.

- Contaminant concentrations in the most recent influent to the B995 treatment facility were well below surface water ALs except for acetone, copper, zinc, and mercury. As a consequence of the closure activities, the sources of these constituents were removed, or if present in the sewer lines, the pathway of contaminant release to surface water was disrupted.
- Large volumes of relatively clean water continued to flush the system until the sanitary sewer system was closed. This had the effect of further reducing or eliminating contaminated solids within the system.

#### Action/No Further Accelerated Action Recommendation

PAC 000-500 is proposed for NFAA. All of the major contaminant discharges to the sewer system happened prior to 1990. Significant quantities of sewage have been discharged through these lines since these incidents occurred, which has served to flush the lines. Jetting of the main lines served to further eliminate significant solids. Also, infiltration and inflow studies indicate water leaks into the sanitary sewer system, and exfiltration is minimal. Therefore, significant contamination surrounding the sewer lines is unlikely. In addition, shallow sanitary sewer lines and components were removed to a depth of 3 feet below the final grade, and the closure of deeper lines, trunk lines, manholes, and lift stations by grouting, as well as the disruption of some utility trenches, has effectively disrupted contaminant pathways to surface water from the sanitary sewer. The sanitary sewer system is not a significant contaminant source at RFETS.

#### References

EPA and CDPHE, 1999, Correspondence to J. Legare, DOE RFO, from T. Rehder, EPA Region VIII, S. Gunderson, CDPHE, RE: 1997 Annual HRR Review, July.

EP and CDPHE, 2002, Correspondence to J. Legare, DOE RFO, from T. Rehder, EPA Region VIII, S. Gunderson, CDPHE, RE: Approval of NFA Designation for IHSSs & PACs, February 14, 2002.

DOE, 1992, Historical Release Report for the Rocky Flats Plant, Rocky Flats Plant, Golden, Colorado, June.

DOE, 1997, OU 1 Corrective Action Decision Record of Decision, Rocky Flats Environmental Technology Site, Golden, Colorado, February.

DOE, 1999, Annual Update, Historical Release Report, Rocky Flats Environmental Technology Site, Golden, Colorado, September.

DOE, 2002, Annual Update, Historical Release Report, Rocky Flats Environmental Technology Site, Golden, Colorado, August.

DOE, 2003, Environmental Restoration RFCAs Standard Operating Protocol for Routine Soil Remediation, Modification 1, Rocky Flats Environmental Technology Site, Golden, Colorado, September.

DOE, CDPHE, and EPA, 2003, Modifications to the Rocky Flats Cleanup Agreement Attachment, U.S. Department of Energy, Colorado Department of Public Health and

Environment, and U.S. Environmental Protection Agency, Rocky Flats Environmental Technology Site, Golden, Colorado, June.


DOE, 2004a, Technical Memorandum – Closure Strategy for the Rocky Flats Environmental Technology Site Sanitary Sewer System, Golden, Colorado August.

DOE, 2004b, Rocky Flats Environmental Technology Site, Integrated Monitoring Plan Background Document, Golden, Colorado FY2004.

DOE, 2004c, Facility Disposition RFCA Standard Operating Protocol, Rev 1, Rocky Flats Environmental Technology Site, Golden, Colorado, March.

DOE, 2004d, Environmental Restoration, RFCA Standard Operating Protocol for Routine Soil Remediation, FY03 Notification #04-04, IHSS Group 700-3, Rocky Flats Environmental Technology Site, Golden, Colorado July.

Figure 1 PAC 000-500 Sanitary Sewer Systems Location Map

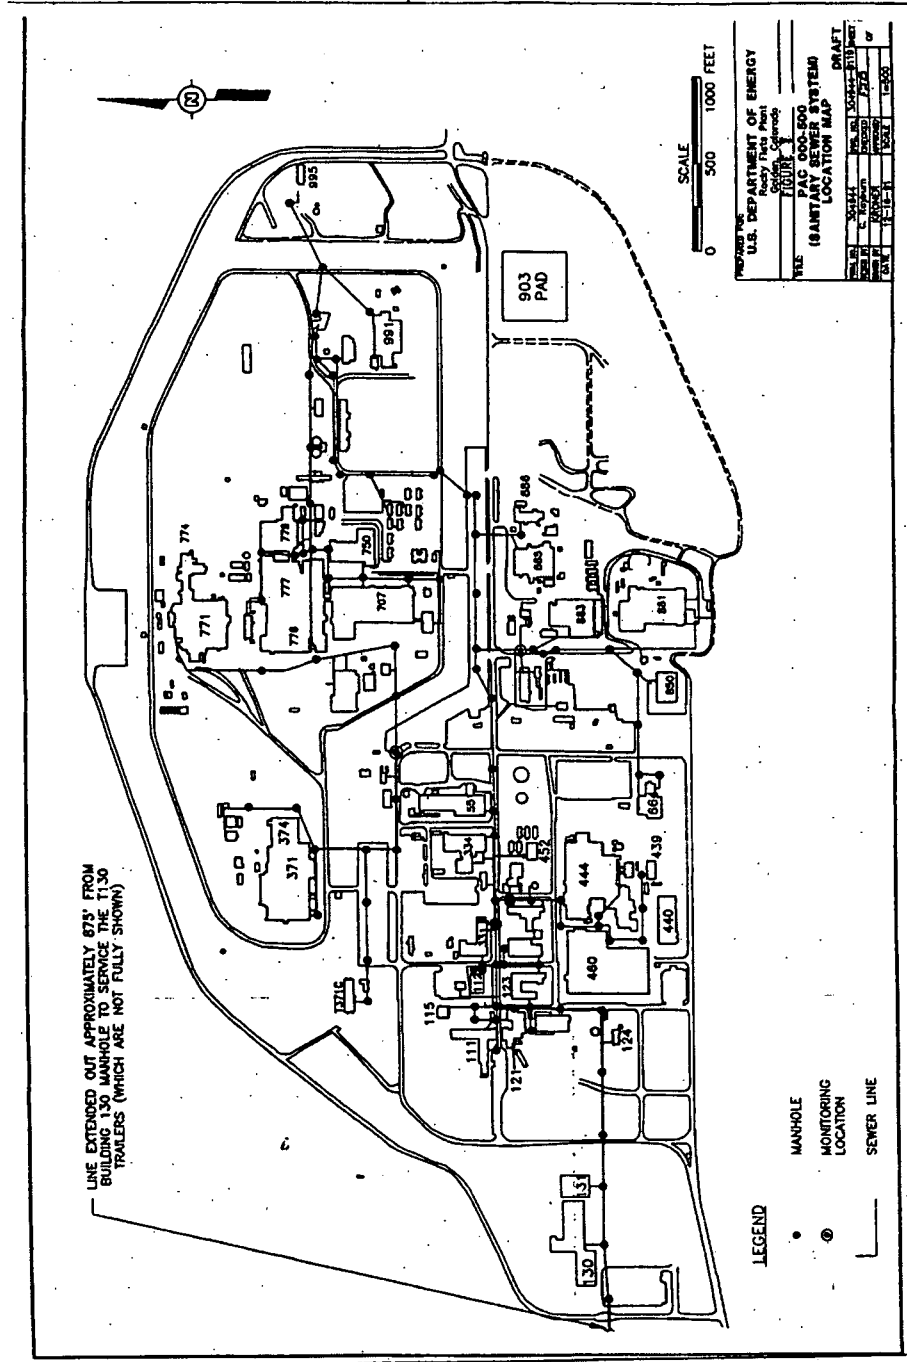



**Figure 2**  
**Sanitary Sewer System**  
**At Closure As of 2/24/05**


**EXPLANATION**

**Sewer & Components**

- Closed in place
- ##### Removed
- x Cut & Cap
- o Manhole
- ▲ Lift Station
- Cleanout
- Disrupt Utility Trenches
- Proposed Utility Trench Disrupt

**Standard Features**

- Demolished facility
- Remaining facility
- Pond
- - - Demolished road
- Paved road
- Dirt road
- Stream, ditch

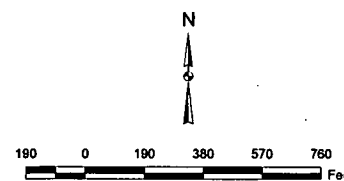


State Plane Coordinate Projection  
 Colorado Central Zone (3476)  
 Datum: NAD27

U.S. Department of Energy  
 Rocky Flats Environmental Technology Site

Prepared By:  
 CH2MHILL  
 GIS DEPT. (303) 966-7707

Prepared For:  
 KAISER HILL  
 COMPANY

DATE: 3/7/2005

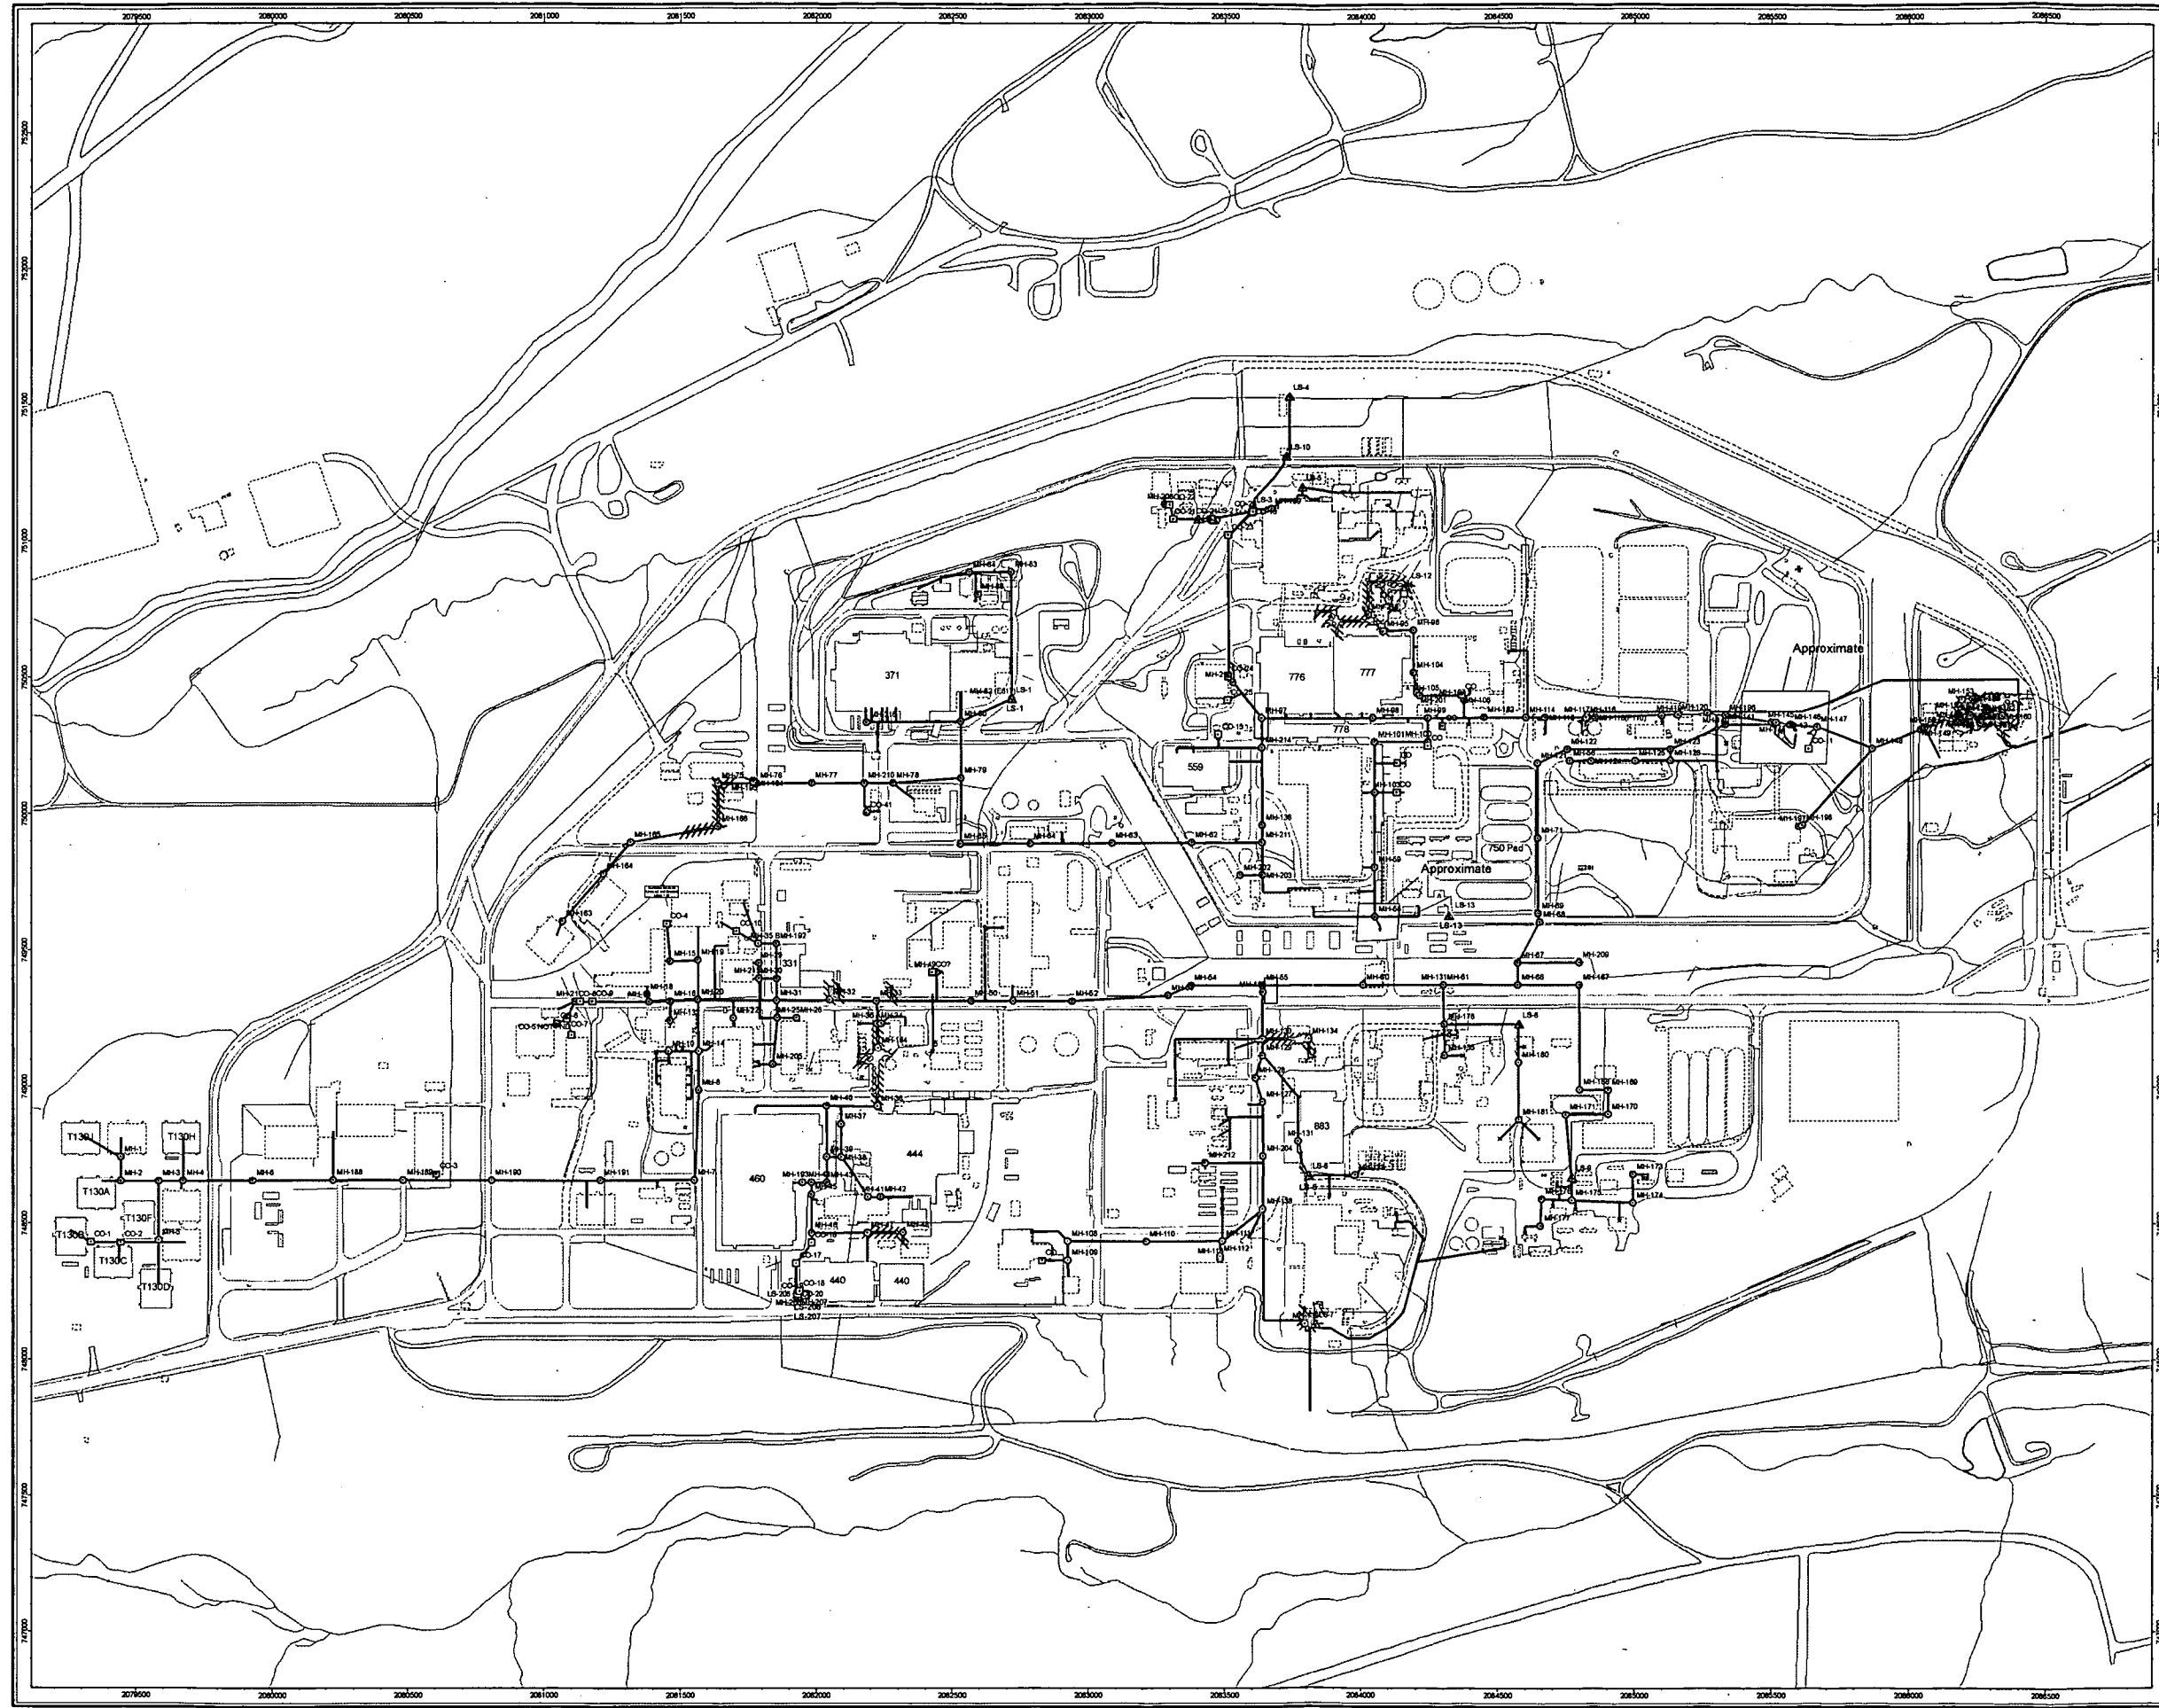

PATH: \\nasrv\GIS\GIS\_User\_Comm\ERP\Projects\F2004000-3ISS\_MH\_LS\_2\_24\_05\_v1.mxd

Figure 3

Sanitary Sewer System  
Surface Soil and  
Waste Sample Results


EXPLANATION

Sewer & Components

- Closed in place
- ////// Removed
- x Cut & Cap
- Manhole
- ▲ Lift Station
- Cleanout
- Utility Trench Disrupt
- Proposed Utility Trench Disrupt
- ★ Waste Samples > WRW ALs  
(Analytes shown are at concentrations > WRW ALs)
- ★ Waste Samples < WRW ALs
- \* Surface Soil Sample  
(Analytes shown are at concentrations > Background)

Standard Features

- Demolished facility
- Remaining facility
- Pond
- - - Demolished road
- Paved road
- Dirt road
- Stream, ditch

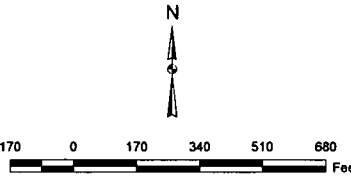

State Plane Coordinate Projection  
Colorado Central Zone (3478)  
Datum: NAD27

U.S. Department of Energy  
Rocky Flats Environmental Technology Site

Prepared By:  
 CH2MHILL  
GIS DEPT. (303) 966-7707

Prepared For:  
 KAISER HILL  
COMPANY

DATE: 3/9/2005

Location	Analyte	Result	Wrwal	Units
CE49-014	Arsenic	28	22.2	mg/kg

Location	Analyte	Result	Wrwal	Units
AA83-063	Chromium	1300	258	mg/kg
AA83-063	Uranium-235	9.814	8	pCi/g

Location	Startdepth	Enddepth	Analyte	Result	Background	Wrwal	Units
CF33-014	0	0.3	Barium	703	141	28400	mg/kg
CF33-014	0	0.3	Chromium	68.8	17	258	mg/kg
CF33-014	0	0.3	Iron	28800	18037	307000	mg/kg
CF33-014	0	0.3	Nickel	37.4	15	20400	mg/kg
CF33-014	0	0.3	Strontium	300	49	813000	mg/kg
CF33-014	0	0.3	Uranium-234	5.184	2.25	300	pCi/g
CF33-014	0	0.3	Uranium-235	0.3375	0.094	8	pCi/g
CF33-014	0	0.3	Uranium-238	5.184	2	351	pCi/g
CF33-014	0	0.3	Vanadium	97.8	46	7150	mg/kg
CF33-014	0	0.3	Zinc	289	74	307000	mg/kg

**Figure 4 Best Management Practices at Manholes**


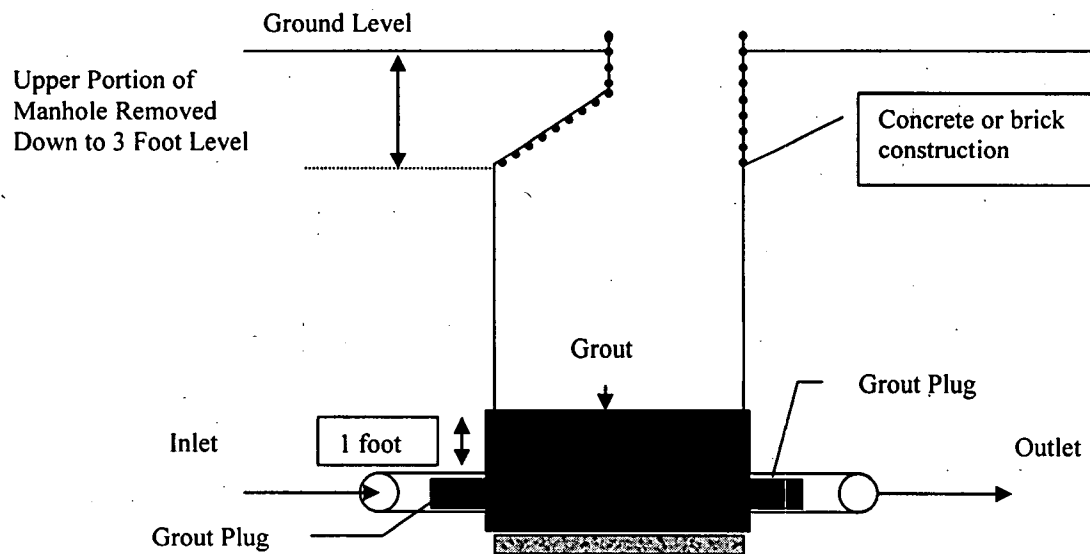


Figure 5 Contaminant Pathway to Surface Water Disruption

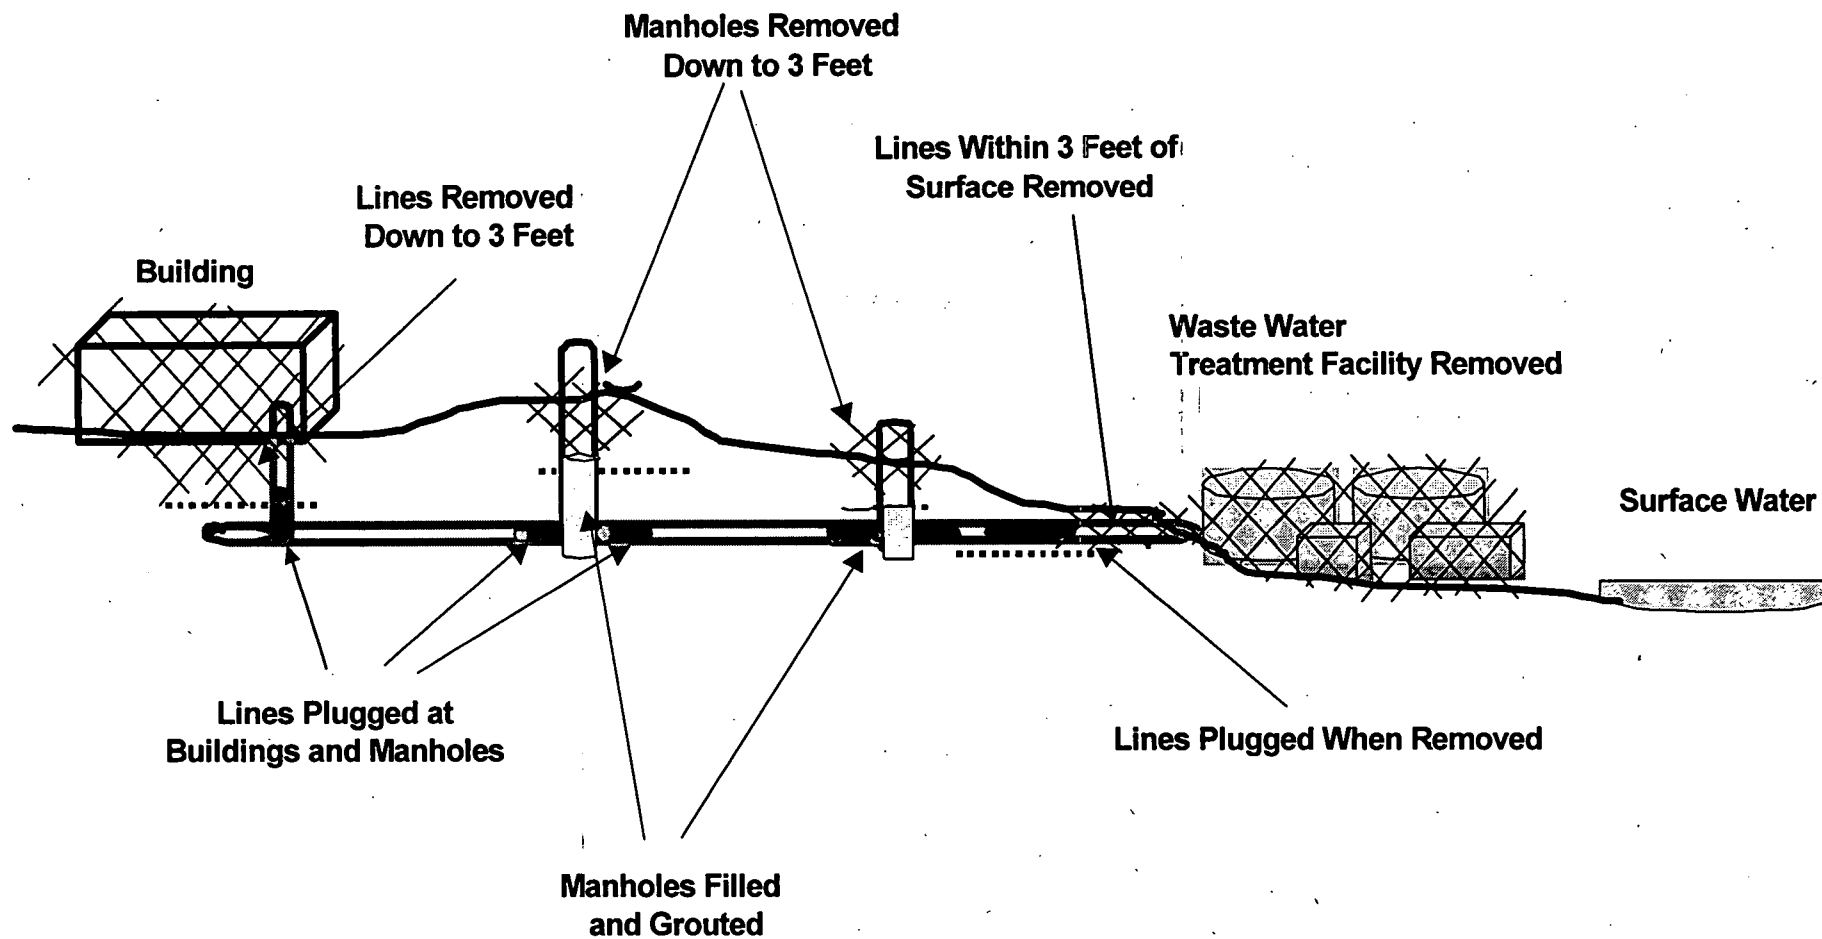

**ATTACHMENT 1  
TECHNICAL MEMORANDUM**

**CLOSURE STRATEGY FOR THE ROCKY FLATS ENVIRONMENTAL  
TECHNOLOGY SITE**

**SANITARY SEWER SYSTEM**

**Technical Memorandum**

**Closure Strategy for the Rocky Flats  
Environmental Technology Site**

**Sanitary Sewer System**

**Final**

**August 31, 2004**

## Table of Contents

1.0	Introduction.....	1
1.1	Project Approach .....	1
1.2	Interface with WWTF Cluster Closure .....	2
1.3	Interface with Other Building D&D Activities.....	2
2.0	Background Information .....	3
2.1	Influent to the Sanitary Sewer System.....	5
2.2	Non-Sanitary Discharges to the Sanitary Sewer System .....	5
2.3	Potential for Residual Contamination in Sanitary Sewer System.....	7
2.3.1	Potential for Contaminated Solids in Sanitary Sewer System.....	7
2.4	Sanitary Sewer Lines – Existing Conditions .....	9
2.5	System Assessments .....	9
2.5.1	Zero Discharge Study.....	9
2.5.2	Infiltration and Inflow Evaluations .....	9
2.6	Releases from the Sanitary Sewer System .....	10
3.0	Potential Contamination Associated with the Sanitary Sewer System .....	10
3.1	Contaminated Sewer Lines.....	11
3.1.1	Building 442 – IHSS Group 400-7 .....	11
3.1.2	Building 441 – IHSS Group 400-8 .....	13
3.1.3	Building 779 – IHSS Group 700-7 .....	13
3.2	Biosolids Data.....	14
3.2.1	NPDES Data.....	14
3.2.2	NTS Data .....	14
3.2.3	DOE Order 5400.5 Sample Results .....	14
3.2.4	Summary of Biosolid Sample Data.....	15
3.3	Influent Data.....	15
4.0	Proposed Approach.....	16
4.1	No Further Accelerated Action Justification.....	16
4.2	Proposed Path Forward.....	17
4.2.1	Proposed Grab Sampling .....	17
4.2.2	Best Management Practices Proposed at Manholes, Cleanouts and Utility Trenches.....	18
4.2.3	Best Management Practices at Lift Stations.....	19
4.2.4	Best Management Practices at WWTF .....	20
4.2.5	Abandoned Sanitary Sewer Lines .....	21
5.0	Conclusions and Recommendations.....	21
6.0	References .....	24

## Appendices

Appendix A - Biosolids Data .....	A-1
Appendix B – Building 995, Sewage Treatment Plant Influent Data.....	B-1

## Figures

Figure 1 Location Map .....	4
Figure 2 Best Management Practices at Manholes .....	19
Figure 3 Impediments to Flow in Sanitary Sewer System .....	22

## Tables

Table 1 Closure Status of Sanitary Sewer System PAC 000-500 .....	2
Table 2 Sanitary Sewer Line Summary.....	5
Table 3 Non-Sanitary Discharges to the Sanitary Sewer System .....	6
Table 4 Building 442 Sanitary Sewer Line Solids Analytical Results.....	11
Table 5 List of Analytes for Proposed Grab Samples from Sanitary Sewer System .....	18
Table A-1 Summary of Metals Results for Site Biosolids – 1993 to 2002 (in mg/kg) .....	A-1

Table A-2 Biosolid NTS Waste Acceptance Criteria Results – Radionuclides .....	A-1
Table A-3 Biosolid NTS Waste Acceptance Criteria Results – Metals and Organics.....	A-2
Table A-4 Summary of Radionuclides Results and Comparison to RFCA WRW Action Levels .	A-3
Table B-1 Summarized Radionuclide Results for WWTF Influent .....	B-1
Table B-2 Summarized Metal Results for WWTF Influent .....	B-1
Table B-3 Summarized Organic Results for WWTF Influent .....	B-2

### Acronyms and Abbreviations

ALF	Action Level Framework
ALs	Action Levels
ASI	Advanced Sciences, Inc
CAD	Corrective Action Decision
CBOD5	carbonaceous biochemical oxygen demand
CDPHE	Colorado Department of Public Health and Environment
D&D	Decontamination and Decommissioning
d/m/l	Disintegrations/minute/liter
DOE	Department of Energy
DOP	Diethyl phthalate
EPA	Environmental Protection Agency
ER	Environmental Restoration
FFCA	Federal Facilities Compliance Agreement
IASAP	Industrial Area Sampling and Analysis Plan
IHSS	Individual Hazardous Substance Site
ISCORS	Interagency Steering Committee on Radiation Standards
KH	Kaiser-Hill Company, LLC
MEK	Methyl ethyl ketone
MGD	million gallons per day
mg/kg	milligram per kilogram
nCi/g	nanoCuries/gram
NFAA	No-Further Accelerated Action
NPDES	National Pollutant Discharge Elimination System
NRC	Nuclear Regulatory Commission
NTS	Nevada Test Site
OU 1	Operable Unit 1
PAC	Potential Area of Concern
PA	Protected Area
PAH	polyaromatic hydrocarbons
pCi/g	picoCuries per gram
pCi/l	picoCuries per liter
PPE	personal protective equipment
PPM	parts per million
PVC	polyvinyl chloride
RCT	Radiological Control Technician
RFCA	Rocky Flats Cleanup Agreement



---

RFETS	Rocky Flats Environmental Technology Site
RLCR	Reconnaissance Level Characterization Report
ROD	Record of Decision
RSOP	RFCA Standard Operating Protocol
TCLP	Toxicity Characteristic Leaching Procedure
VCP	vittrified clay pipe
ug/kg	microgram per kilogram
WRW	Wildlife Refuge Worker
WWTF	Wastewater Treatment Facility

## 1.0 Introduction

This document provides the closure strategy for the Rocky Flats Environmental Technology Site (RFETS) sanitary sewer system. The sanitary sewer system is part of Individual Hazardous Substance Site (IHSS) Group 000-3 that consists of Potential Area of Concern (PAC) 000-500 – Sanitary Sewer System, PAC 000-505 – Storm Drains, IHSS 143 – Old Outfall at Building 771, and IHSS 190 – Central Avenue Ditch Caustic Leak. This document describes the approach for closure of the sanitary sewer system components. Separate closure documents will be produced as required for the closure of components, including a No Further Accelerated Action document for IHSS Group 000-3.

There are three main components to the sanitary sewer system other than those addressed by Wastewater Treatment Facility (WWTF) closure: main sewer lines not associated with buildings, smaller sanitary sewer lines associated with buildings, and abandoned lines. Major components of the sanitary sewer system are addressed based on available data and process knowledge.

Sanitary sewer lines associated with buildings are removed by the facility if within three feet of final grade. Associated potential contamination is addressed through an Environmental Remediation (ER) Rocky Flats Cleanup Agreement (RFCA) Standard Operating Protocol (RSOP) notification for the appropriate IHSS Group, if applicable. The main sanitary sewer system and the storm drains are addressed as part of IHSS Group 000-3. The WWTF will be closed following closure of the sanitary sewer lines as a separate project. However, this document addresses the project approach for dispositioning all of the sanitary sewer system.

## 1.1 Project Approach

A closure strategy for the sanitary sewer system was developed that is a coordinated effort between WWTF operations, decommissioning projects and environmental restoration. The following data were utilized to develop the approach and are discussed in later sections:

- Historic information such as discharges to the sewer, reported leaks, studies and line evaluations to identify potential contaminant types, and condition of the system;
- Biosolid and influent data to provide information on current and historical average contaminant levels within the sanitary sewer system; and
- Previously removed sanitary sewer lines at Building 442 and Building 441 provide information on potential contaminant levels in the piping and surrounding soils.

After the routine maintenance and operations of the WWTF is complete (expected September 2004), the following approach will be implemented:

- Demolish the WWTF;
- Remove building-related sanitary sewer lines and components with the associated buildings; and
- Close remaining known abandoned sanitary sewer lines
  - > Obtain no further accelerated action for sewer lines based on process knowledge
  - > Remove lines within three feet of the surface
  - > Implement additional Best Management Practices.

Table 1 shows the closure strategy and status for the Sanitary Sewer System.

**Table 1 Closure Status of Sanitary Sewer System PAC 000-500**

<b>Sanitary Sewer Component</b>	<b>Closure Strategy and Status</b>	<b>Documentation</b>
Building 995 Wastewater Treatment Plant	Closure And Removal	Facility Disposition RSOP (DOE, 2000)
Sewer lines beneath and near Buildings	Remove within 3 feet of surface as Buildings are closed – flush lines, plug and survey pipe ends	Closure Strategy For Sanitary Sewer System - Best Management Practice
Operating Lines and Manholes	Operate until closure of Treatment Facility – remove manholes to 3 feet below final grade, plug and survey pipe ends	Closure Strategy For Sanitary Sewer System - Best Management Practice
Abandoned Lines	Where known, remove to within 3 feet of final ground surface – plug and survey pipe ends	Closure Strategy For Sanitary Sewer System - Best Management Practice
<b>Sanitary Sewer Components in other IHSS Groups</b>		
PAC 700-144 Sewer Line Break	Will be closed under IHSS Group 700-3	ER RSOP notification letter
PAC 800-145 Sanitary Waste Line	Closed through the Operable Unit 1 (OU 1) Corrective Action Decision/Record of Decision (CAD/ROD) (DOE, 1997)	OU 1 CAD/ROD (DOE, 1997)
PAC 800-106	Closed through the OU 1 CAD/ROD (DOE, 1997)	OU 1 CAD/ROD (DOE, 1997)
PAC 900-141 Sludge Dispersal	No Further Action Approval	1999 Annual Update to Historical Release Report (DOE, 1999)
PAC 100-604 T130 Complex Sewer Line Breaks	No Further Action Approval	2002 Annual Update to Historical Release Report (DOE, 2002a)

The Inner East and West Guard Shacks (Buildings 100 and 900) had independent septic leach fields and did not connect to the sanitary sewer system. On average, only 4 or 5 people were assigned to each guard post and potentially used these facilities. The structures associated with these leach fields will be removed to three feet below grade and are not part of this strategy.

## 1.2 Interface with WWTF Cluster Closure

The Site's WWTF also known as B995 cluster, contains buildings 971, 972, 973, 974, T974A, 975, 976, 977, 988, 988A, and 990 as well as the influent and effluent storage tanks and the discharge line along the B-Series Ponds. This cluster is anticipated to close in 2004. As part of Site Closure, all buildings, tanks and other related structures will be removed to a depth of three feet below final grade. The sanitary sewer lines and manholes within the cluster will be removed to a minimum depth of three feet below the final grade and associated pipe bedding material will be disrupted to eliminate or minimize potential pathways to surface water. Any remaining sewer lines in this cluster will be plugged and capped.

## 1.3 Interface with Other Building D&D Activities

As discussed in the Facility Disposition RFCA Standard Operating Protocol (RSOP) (Department of Energy [DOE], 2000) and the ER RSOP for Routine Soil Remediation (DOE, 2003a), prior to building demolition, sanitary sewer lines within the building are flushed with domestic water. Flushing consists of high volume, short duration clean water flows of at least five times the total volume of the sewer line being flushed.

There is probably little benefit from this action. However since the lines are available and still accessible, this is an appropriate action as a best management practice for closure to remove

solids and trapped debris within the line. Flushing is coordinated with WWTF to ensure the high volumes of water and/or sediment associated with flushing can be accommodated.

After the flushing is completed, all openings to the sanitary sewer within the building are plugged with a watertight seal to keep the pipe closed during decontamination and decommissioning (D&D). The sanitary sewer lines are then cut and the open ends plugged with a watertight permanent seal such as a cement plug outside the building footprint at a convenient location close to the building but away from ongoing building activities. Sanitary sewer lines less than three feet below grade are removed and open ends plugged as above. At closure, a map with the location of the plugged ends will be documented in the Administrative Record as part of Site closure conditions.

Flushing of the buildings also serves to flush out the main lines. The sanitary sewers in the more contaminated buildings will be flushed and closed first as possible, followed by the cleaner buildings on the same line to accomplish this task. Where this is not possible, then the same volume of water used to flush out the sanitary sewer lines for the cleaner buildings will be placed into the system after closure of the more contaminated buildings. This will primarily be done using fire hoses placed into manholes upgradient of the contaminated buildings.

## 2.0 Background Information

Installation of the sanitary sewer system and associated treatment plant began around 1952 (DOE, 1992). The estimated total length of the sanitary sewer lines is approximately 67,000 feet including active and abandoned lines. The diameter of the lines ranges from 3 to 12 inches with about 30,000 feet of 6-inch and larger lines and about 11,500 feet of 4-inch lines (DOE, 2002b). The lines include vitrified clay pipe (VCP), polyvinyl chloride pipe (PVC), cast iron and ductile iron pipe. PVC lines were installed in 1984 or later. In 1985, some of the system was rehabilitated to reduce infiltration and leakage (Advanced Sciences, Inc [ASI], 1991). The sanitary sewer system is shown in Figure 1.

The sanitary sewer collection system flows by gravity from west to east across the Industrial Area. However, some facilities, such as the Building 881 and Building 771 clusters, also have lift stations to pump sewage where gravity flow is not possible. There are two sections of the sanitary sewer system: the north section collects flow from the plant area formerly located within the Protected Area (PA) and also the 371 trailers, B116 and T117A; the south section collects flow from the rest of the plant exterior to the PA. The two sections join at Building 990.

From Building 990, wastewater flows into one of three 110,000-gallon influent storage tanks at WWTF allowing inflow to be collected while another tank holding the previous day's flow is processed (DOE, 2001). The Site's wastewater treatment plant is an activated sludge treatment facility with a design capacity of 0.5 million gallons per day (MGD). In 2003, normal flows were approximately 0.16 MGD. The flow rate continues to decline as the Site closes.

The lengths of various main sewer lines types were calculated based on Figure 1 and are presented in Table 2. The lengths presented are only for the main lines. Numerous smaller lines and laterals are associated with the buildings and were not included in this estimate.

As shown on Table 2, about half of the active lines are already flushed and significant portions of the sanitary sewer lines are already abandoned (43%) including 17% of the total that were flushed prior to abandonment. These numbers may be low because many of these abandoned lines are believed to be flushed, plugged, or removed. In addition, an effluent line that runs from the wastewater treatment plant was included in the calculations even though this line was exposed only to treated water and does not need to be flushed.

**Figure 1**  
**Sanitary Sewer System**  
**Location Map**

**Explanation**

- Manhole
- Cleanout
- Manhole Sampling Location
- Sanitary Sewer
- Sanitary Sewer, Flushed
- Abandoned, Flushed and Plugged
- Abandoned, Flushed
- Abandoned Previously
- Sewer on Drawing but not Located
- Sanitary Sewer, Removed OLD
- Outfall Sanitary Sewer
- 1982 Infrastructure
- Disrupt Utility Trenches
- Standard Map Features
- Buildings and Other Structures
- Demolished
- Standing
- Drill Roads
- Paved Roads

**NOTES:**  
Manholes (circular point features) and Cleanouts (square point features) follow the same color coding as the sanitary sewer lines. (Sanitary Manholes have blue cross hatch.)  
Abandoned Lines with a squiggly line were abandoned before 1990.  
Abandoned lines without a squiggly line were abandoned after 1990.




Scale 1:3600  
1 inch = 300 Feet

State Plane Coordinate Projection  
Colorado Central Zone  
Datum: NAD 27

U.S. Department of Energy  
Rocky Flats Environmental Technology Site


Prepared by:



Prepared for:



Date: July 17th, 2004

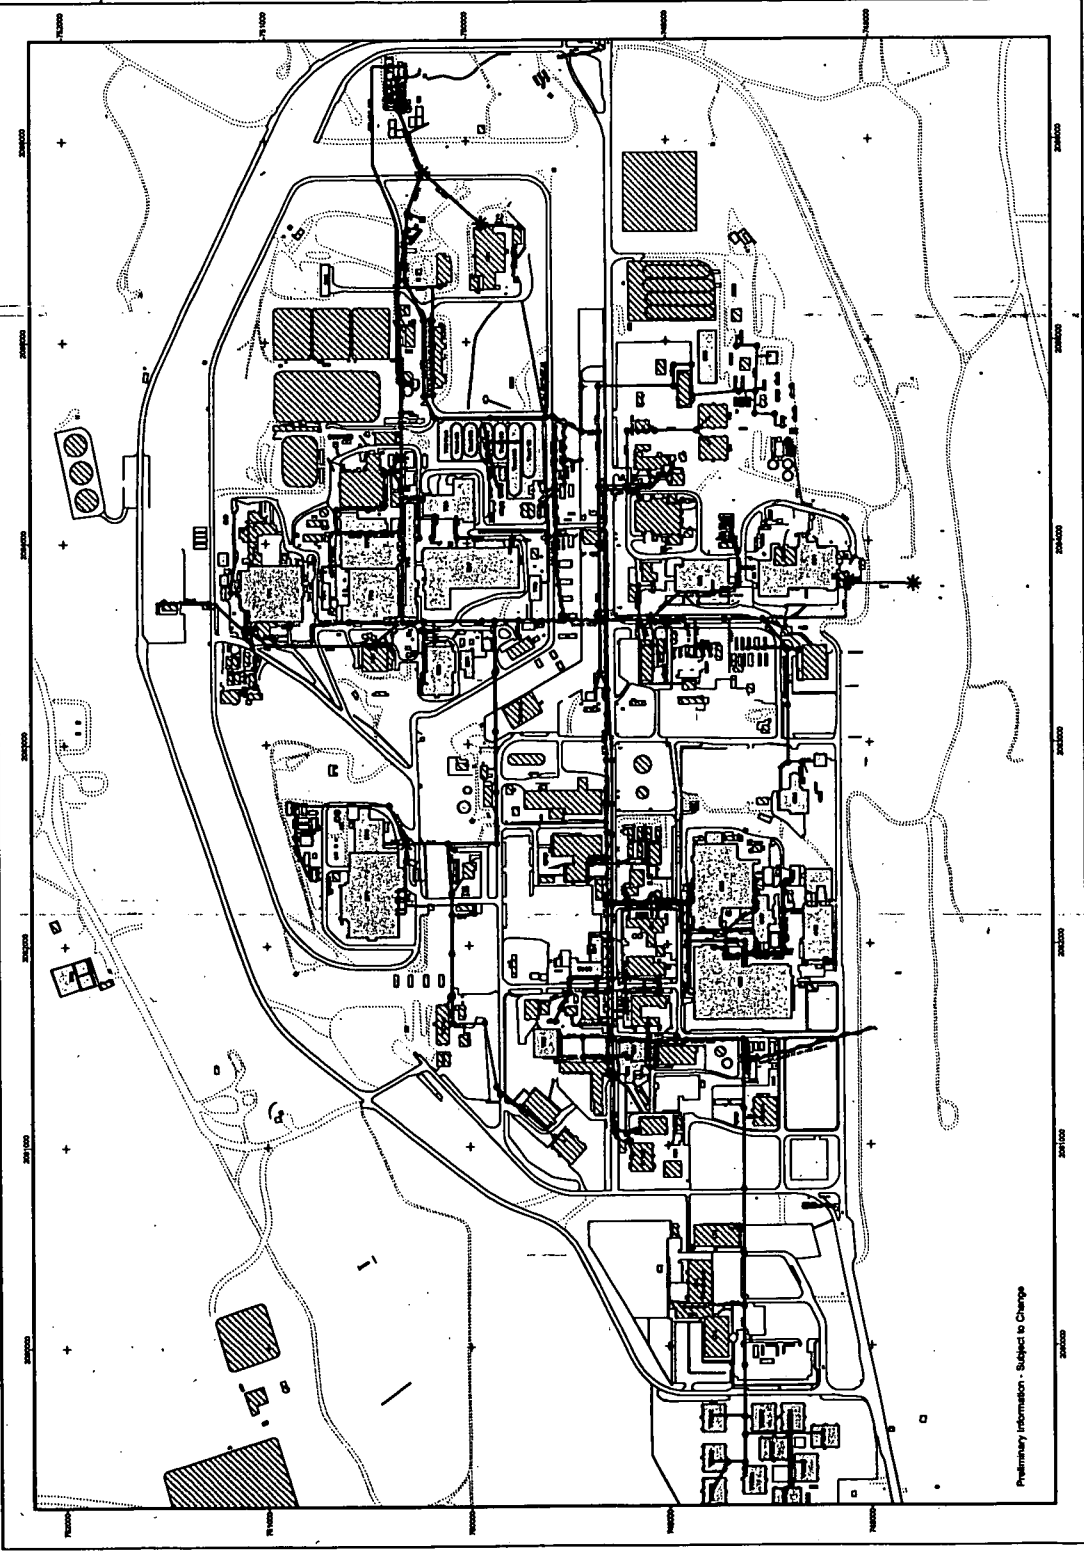

Preliminary Information - Subject to Change

**Table 2 Sanitary Sewer Line Summary**

	Length (feet)	Length (miles)	Percentage of Total Lines
<b>Current Sanitary Sewer Lines</b> These lines will be flushed and plugged or removed at closure	37,039	7.01	57%
<b>Previously Abandoned Lines</b>	27,998	5.30	43%
Abandoned Lines, Flushed and Plugged	7,009	1.33	11%
Abandoned Lines, Flushed	3,800	0.72	6%
Older Abandoned Lines	15,520	2.94	24%
Abandoned Lines, Not Located	1,072	0.20	2%
<b>Total Lines</b>	<b>65,037</b>	<b>12.32</b>	<b>100%</b>

Manhole inspections and photographs indicate that sanitary sewer lines are generally greater than three feet below grade with the exception of the lines in the 130-trailer complex on the west side of the Site. Lines associated with buildings are generally less than three feet below grade because the system relies on gravity flow and shallower lines are required for flow from the buildings into the main lines.

## **2.1 Influent to the Sanitary Sewer System**

Within Site buildings, various drains, sinks, sumps, and toilets discharge to collection lines and then to the main lines that transport the wastewater to WWTF. Process wastes are managed in a separate system from sanitary wastes. In every Site building, waste discharge points (drains, sinks, sumps, etc.) are designated as either "sanitary drain" or "process drain". Process waste drains are plumbed separately into the Process Waste System. In some plant facilities, wastes are, or have historically been, collected and temporarily stored in tanks piped into both systems, and transferred to the appropriate system based on analytical results (DOE, 1992).

Historically, some storm water sources, such as roof drains, were connected to the sanitary sewer system. These were disconnected and there are no known cross connections between the storm drain and the sanitary sewer system (ASI, 1991). In addition, cooling tower sumps were generally pumped into the sanitary sewer system to dispose of cooling tower blowdown water. These are disconnected as the cooling towers are decommissioned.

## **2.2 Non-Sanitary Discharges to the Sanitary Sewer System**

In the past, some non-domestic wastes were discharged into the sanitary sewer system. These discharges changed over time in response to internal guidelines and to State and Federal regulations. Much of the potential contaminants discharged to the sanitary sewer system were derived from laundry waste. A 1967 survey indicated that of the average daily flow of 250,000 gallons, 21,000 gallons were laundry waste. However, a 1973 investigation of plutonium releases to the sanitary sewer system indicated that 88% of the plutonium in the sanitary sewer system at that time originated from the numerous laundries on Site (DOE, 1992). This primary source of contaminated discharges was eliminated when potentially contaminated laundry began being laundered offsite in 1996. There is potential for liquids to be dumped into the sanitary sewer by employees but this is not expected to be significant.

Table 3 summarizes information compiled on the currently known non-sanitary waste streams discharged into the sanitary sewer system through 1991. A few other, non-documented non-sanitary releases to the system may also have occurred during this timeframe. For example, there is information that process waste backed up and caused a toilet in B701 to overflow.

Excluded from Table 3 are discharges of compounds not anticipated to be contaminants of concern such as acids, dyes, unneutralized demineralization waste from the steam plant, ethylene glycol, and oil. A complete listing is found in the Historical Release Report (DOE, 1992).

**Table 3 Non-Sanitary Discharges to the Sanitary Sewer System**

Waste Type	Description
Lab Wastes	8/1953 & 4/1965 - Building 123 laboratory waste with high nitrates and unspecified radioactivity from urinalysis specimens. Unknown - Building 331 Old Lab Area had unspecified radioactive contamination around footing drains plumbed into sanitary sewer.
Laundry waste	1953 - Unknown Building 442 Laundry waste water discharged with varying radioactivity levels 9/55 - 2,700 gallons of laundry waste discharged with alpha radioactivity exceeding 8,500 disintegrations/minute/liter (d/m/l) discharged while leaks in Building 881 process waste line were repaired. 1986 - Building 444 Elevator shaft sump and employee wash facilities are plumbed into sewer; small amounts of uranium oxide and beryllium potentially entered sanitary sewer. 1953 - Unknown Building 771 Laundry waste exceeding the radioactivity limit for direct discharge to Walnut Creek is diluted with sanitary sewer system effluent to meet discharge limits. Building 881 Process waste and laundry waste discharged to sanitary sewer. 1952-53 discharge limit is 10,000 d/m/l. 1954 discharge limit is 8,500 d/m/l. 1956 discharge limit suspended for indefinite period. 1986 - Document states that 2 restrooms in Building 883 are in use where workers do not have to cleanup prior to use.
Hexavalent chromium	Mid-1962 - Several discharges of oil and hexavalent chromium waste. 6/26/63 - Unknown amount of hexavalent chromium solution discharged. 5 parts per millions (ppm) hexavalent chromium at WWTF settling tank; 0.6 ppm at effluent. 12/12/63 - Unknown quantity of hexavalent chromium solution discharged to the sanitary sewer; 20 ppm was detected at settling tank, 0.18 at effluent. 2/1989 - Chromic acid stored in Building 444 overflowed tanks and a containment berm and entered the building's foundation drains. The spill collected in a sump that automatically transferred to the sanitary sewer system with an estimated 30 pounds of chromium released to the sanitary sewer system. After the chromic acid release, Building 444 foundation drains were plumbed to process waste system.
Process waste	11/1964 - Releases to sanitary sewer because of leaks in process waste lines from Buildings 441, 444, 881 and 883. 1974 - A document states that radioactive waste from Building 779 was pumped to sanitary sewer if it does not exceed unspecified discharge limits. 1978 - A document states that all drains in the Building 705 research facility drained to the sanitary sewer system. Uranium, beryllium, chromium and acids were used at this location. 1978 - A building 881 process waste sink was found to be plumbed into sanitary sewer. 1979 - A document states that unspecified chemicals from Building 559 disposed into sanitary drain. 1966 - Documents allow up to 500 milliliters of unspecified acids, bases and solvents can be discharged into sanitary sewer in Building 991.
Paint	9/11/70 - Silver paint used in Building 444 poured down unspecified drain and cleaned up. 1980 - Unspecified type and amount of paint released from Building 374 into sanitary sewer. Spill was controlled without reportedly causing environmental impact. 1990 - Building 374 discharged paint containing volatile organic compounds to the sanitary sewer.
Radioactive iodine	7/24/79 - Unknown amount of iodine-131 was released to the sanitary system as a result of an employee medical treatment. 8/09/79 - Unknown amount of iodine-131 was released to the sanitary system as a result of an employee medical treatment.
Tritium	4/73 - 5/73 - An estimated 50 - 100 curies of tritium were inadvertently released from Building 779 to the sanitary sewer system. One release contained an estimated six curies of tritium in 7,800 gallons of waste, and a second release contained an estimated 44 curies in 8,000 gallons of waste. 8/17/79 - 2,000 picoCuries per liter (pCi/l) were detected in effluent. Source was the steam condensate from Buildings 771, 776 and 779 that originated as Solar Evaporation Pond water. 1,000 gallons per hour were discharged until October 1979.
Scrubber solution	10/25/89 - Scrubber system in Building 444 overflowed. Effluent showed higher alpha and beta radioactivity than normal.

In 1991, EPA and DOE entered into the National Pollutant Discharge Elimination System (NPDES) Federal Facilities Compliance Agreement (FFCA) that implemented more controls over non-sanitary releases to the sanitary sewer system. Based on a review of spill records compiled since 1991, only a few spills are known that may have introduced potential contaminants of

concern into the sanitary sewer system. Most of the recent spills into the system were small, less than 100-gallon quantities of ethylene glycol or oils. The following discharges since 1991 are currently documented:

- 1994 – 7 gallons of photographic developer/fixer solution released into the sanitary drain in B111. Floor area investigated in 2001 and determined to require no action.
- 1995 – approximately one pound of mercury was spilled onto the floor in Building 443. Most of the mercury was believed to be caught in the floor drain P-trap and was retrieved.
- 1997 – approximately 50 gallons of water with NALCO inhibitor, a possible chromium source, was discharged into the sanitary sewer from the B460 cooling tower.

## 2.3 Potential for Residual Contamination in Sanitary Sewer System

The potential for contamination in the sanitary sewer system is based on the historical use of the system, the history of contaminant releases, and characteristics of the sludge from the system.

Historically, there are two potential sources of contamination that could impact the sanitary sewer:

- 1) Accidental discharges of liquids with higher levels of contamination than routine waste streams; and,
- 2) Discharges of laundry waste.

Contaminated liquids discharged to the sanitary sewer system were more common in the past. Potential contamination incidents mostly occurred in the 1950s and 1960s, along with discharge from laundries that had higher contaminant loading (see Section 2.2). Older abandoned lines or lines that have seen little use since they carried more contaminated sewage might still have residual contaminated solids such as the lines found at Building 442. In addition, recent sampling and other characterization has shown that there is fixed contamination in some of the sumps and lift stations along with some residual contaminated solids. As examples, the B881 lift station contained sediment with low levels of uranium. The lift station was removed during demolition activities. The B771 lift station did not contain contaminated sediment, but there is evidence that fixed contamination was present on this structure when it was closed in-place. As other areas are characterized during closure and as part of the sampling described in Section 4.2.1, there is the potential for finding other areas with residual contamination.

The current sewage influent is not generally a source of contamination because of better spill control, and the lack of contaminated sources discharging into the sewer. Because of the controls currently in place over what can be discharged to the sanitary sewer system, the current discharge into the sanitary sewer tends to flush the system of contaminants. The sewage treatment plant effluent is always below action levels. The influent into the WWTF is generally well below radiological action levels. However, two samples collected recently by Colorado Department of Public Health and Environment (CDPHE) were above the action levels. A sample collected from the influent into the WWTF in December 2003 showed Americium 241 at 0.55 pCi/l, above the surface water action level of 0.15 pCi/l. A sample collected in January 2004 from the north leg of the sanitary sewer system had an elevated Plutonium 239/240 activity of 0.336 pCi/l, above the surface water action level of 0.15 pCi/l. While such activities are uncommon, these indicate that there may be low levels of contamination present in the system.

### 2.3.1 Potential for Contaminated Solids in Sanitary Sewer System

There is potential for contaminated solids within the sanitary sewer system. Potential residual contamination in the system is based on the chemical and physical processes that could cause the solids or contaminants in the line.



Physical processes include the build up of material at joints and other places that would not be scoured by flow. In areas at the top of lines that are not constantly exposed to flow, there could be residual solids caked on the inside of the line. Also, since much of the sewer system is gravity-flow, there could be low spots where heavier materials build up. This is probably not as much of a problem since sanitary sewers are periodically cleaned as part of normal operations.

Chemical processes consist primarily of precipitation processes, which could form a scale on the walls of the pipe. However, because of the continual flow, chemical contamination will tend to flow through the pipe rather than remain in the system.

If there is residual contamination in the lines from past releases, it is most likely in joints and other low spots within the system. The length of time since contaminant releases, the large quantity of sewage that has flowed through the lines since the releases, and the fact that many of the lines have been cleaned as part of routine operations, indicate that little contaminated solids are present with the lines. Therefore, most, if not all, of the solids currently within the sanitary sewer system are similar to the biosolids discussed in Section 3.2 of this document.

Following is a discussion on the potential for residual contamination within the sanitary sewer lines that could act as a contaminant source after closure. This information is hypothesized at this time. Additional samples will be collected as described in Section 4.2.1 of this document to determine the potential contamination present.

Scale material resulting from precipitation of contaminants is most likely inorganic, consisting of both metals and radionuclides mixed with organic material. Precipitation is controlled by pH, oxidation-reduction potential, and the concentration of dissolved species. Precipitation will often occur when a liquid system is not in equilibrium or when there are changes in these parameters. Unlike a process waste line where there can be frequent changes in pH and oxidation-reduction potential, a sanitary sewer line is expected to be a much more neutral solution.

Concentrations of materials that could precipitate are expected to be low considering the dilution caused by multiple sources running into the same line. To form precipitates, the liquids in the line have to maintain a certain concentration of ions. So, although precipitates could form, the concentrations are not expected to be high enough for sufficient time to form precipitates. In addition, precipitates that did form could go back into solution.

Based on the above information, it is inferred that significant amounts of precipitates with leachable contaminants are likely not present in the sanitary sewer system. The large quantities of sewage that moved through the sanitary sewer system likely leached out these materials already, if previously present. Even if present, it is not likely that much leaching will occur when exposed to natural waters since the sewage is chemically similar. So although precipitation cannot be ruled out, it does not appear that this is a viable source of contamination.

For these reasons, it is believed that the contaminants found in the influent to the sewage treatment plant represent what is being discharged to the sewer system and are not derived from the lines themselves (see Appendix B). Furthermore, the organic solids in the sewer line are probably more similar to the biosolids recovered at the sewage treatment plant than to materials released in historical short-term releases. It is anticipated that the mechanism for precipitate build up is probably from the day-to-day exposure to metals and other ions in sewage. Finally, even if precipitates should be present they would probably not be in a leachable form since they have been exposed to substantial quantities of sewage that would probably have either similar or greater leaching capability as natural waters.

It appears that the sanitary sewer system is an unlikely source for significant quantities of contamination. However, continued information obtained during building demolition with the additional sampling is proposed to confirm this conclusion as discussed in Section 4.2.1.

## 2.4 Sanitary Sewer Lines – Existing Conditions

In 1999 and 2000, RFETS personnel conducted extensive field inspections of the collection system, including sanitary sewer line inspections using video equipment. In 2000, video inspection of about 20% of the 6-inch and larger main lines of the collection system was completed. The initial inspections showed that many of the lines were partially obstructed with sediment, solids and debris. High-pressure-water jetting and vacuum equipment was used to clean the collection system in July 2000 (DOE, 2001). Most, but not all, of the main feeder lines were cleaned at this time (DOE, 2002b). The manholes were jetted at the same time as the jetting equipment passed through the manholes. However, no special effort was made to clean more than the manhole floor (personal communication, Michael Vess, 2003).

Based on these recent inspections, the system is in good condition overall. One older manhole was repaired to reduce inflow through leaks in the walls. In addition, plastic manhole inserts were installed throughout the system to significantly reduce the amount of inflow (DOE, 2002b). Some VCP lines were found to have been slip-lined and in good condition. Some sections of VCP that were not slip-lined were found to be in good condition, although a few joints were noted with some deterioration, cracking, and leakage. An approximately 1,100 foot-long section of VCP was in questionable condition and has since been slip-lined (DOE, 2002b).

No samples of the material from the cleaning were obtained. However, Radiological Control Technician (RCT) coverage was required for these operations, and no elevated readings were found on any of the equipment, indicating that the main lines of the sanitary sewer system are not radioactively contaminated.

## 2.5 System Assessments

Several assessments of the sanitary sewer system were conducted including Task 1 of the Zero-Offsite Water-Discharge Study (ASI, 1991) and the more recent Infiltration and Inflow Evaluations (DOE, 2002b, 2003b). These investigations are summarized below and assess the potential for the following pathways.

- **Infiltration** - caused by shallow groundwater entering the sanitary sewer system primarily through leaky sewer lines and joints.
- **Inflow** – caused by precipitation or surface water entering the sanitary sewer system primarily through direct connections such as manhole lids and catch basins.
- **Exfiltration** – loss of water under the same conditions as infiltration where the water table is below the sewer line invert elevations or possibly where the line is pressurized.

### 2.5.1 Zero Discharge Study

This report was prepared in 1991 as Task 1 of the Zero-Offsite Water-Discharge Study for the Site (ASI, 1991) and assessed the infiltration and inflow for the period May 1990 through May 1991. Exfiltration, or loss of water into the ground, was estimated to be about 5% of the annual WWTF discharge and within the measurement error for this study. The results of this short-term evaluation also estimated infiltration and inflow to contribute as much as 30% of the flow to the sanitary collection system.

### 2.5.2 Infiltration and Inflow Evaluations

As part of the renewal of the Site's NPDES permit, a new requirement was instituted in 2001 for an annual evaluation of impacts of infiltration and inflow on the Site's WWTF. In 2001, there was an estimated maximum of 20% to 40% infiltration and inflow into the Site's sanitary sewer

collection system, within the range expected for small utilities. As described earlier, several steps were taken at the Site to reduce this amount including lining portions of the collection system, installing manhole inserts, and making repairs as necessary (DOE, 2002b, 2003b).

If the 2001 and 2002 monthly averages are compared to the annual average plus one standard deviation, the peak month in 2001 had a 30% increase in flow, which coincided with the heaviest precipitation event of the year. In 2002, the comparison of monthly flows to the annual average plus one standard deviation showed a 6% increase in flow in June, shortly after the peak precipitation event. This suggests that the repairs implemented in 2001 have had an impact in reducing infiltration and inflow (DOE, 2002b, 2003b), although it is not known how much effect drought conditions also had in that same time period.

These data suggest that infiltration and inflow influence the sanitary sewer collection system with the greatest influence from inflow. It is likely that infiltration at Rocky Flats contributes little to increased flows during wet weather (DOE, 2003b). As the Site closes, the connections to the surface will be eliminated, minimizing the potential for inflow. The repairs, described above, that were made previously are also expected to have reduced infiltration beyond the impact of the recent drought.

## **2.6 Releases from the Sanitary Sewer System**

The following releases are known from the sanitary sewer system to the environment. PAC 700-144 (Sewer Line Break) and PAC 800-145 (Sanitary Waste Line) target releases from sanitary sewer lines, which historically have handled laundry water containing low concentrations of radionuclides. PAC 800-106 was an outfall for an overflow line from a sanitary sewer sump in Building 887 that released untreated sewage. PAC 900-141 (Sludge Dispersal) addresses wind dispersion of radioactively contaminated sanitary system sludges from drying beds near Building 995. PAC 100-604 (T130 Complex Sewer Line Breaks) targets sanitary sewer line leaks in 1990 at the T130 office trailer complex on the west side of the Site (DOE, 1992). These PACs are addressed under the appropriate IHSS Group. As shown in Table 1, all but PAC 700-144 have been dispositioned as No Further Accelerated Action required.

## **3.0 Potential Contamination Associated with the Sanitary Sewer System**

Contamination within the sanitary sewer system is primarily from historic laundering of potentially contaminated laundry and from contaminated releases or spills into the system. As described in Section 2.5, the influence of infiltration has been greatly minimized by recent system improvements. These improvements also minimize the potential for influx of contamination from outside the lines, such as from other adjacent IHSSs or from contaminated groundwater plumes. Contaminant releases into the sanitary sewer system have decreased over the years and generally stopped by the early 1990s when laundry services were consolidated and building specific laundries were no longer used. Onsite laundry of potentially contaminated laundry stopped entirely in 1996. Holdup of residual solids in the line is also minimized by the continued maintenance of the lines including jetting as described in Section 2.4.

While Site Closure has the potential for releasing contaminants into the sanitary sewer system, precautions are in place to prevent this type of release. Building stripout is the most likely source of potential contamination, however, the Facility Disposition RSOP requires that the buildings flush and plug openings to the sanitary sewer prior to decommissioning the building. The cold and dark process also requires isolating the sanitary sewer as well as other utilities prior to decommissioning activities. No other new sources for potential contaminant releases have been identified.

Analytical results for the residual solids in the lines and the biosolids collected at the sewage treatment plant were compared to wildlife refuge worker (WRW) action levels as described in

Section 3.2. While it is not appropriate to compare these data to WRW action levels (ALs) to determine whether an action is needed, this was done to provide a relative assessment of whether the solids in the sanitary sewer system could cause potential impacts to the environment if released. Where sanitary sewer lines are below groundwater levels, the solids within the remaining sanitary sewer lines could potentially be a source of groundwater contamination because the pipes generally are not water tight, allowing flow in and out of the pipes. However, a release to the environment of the solids is unlikely to occur since the sewer system will be disrupted to prevent flow through the system whereas soil is more or less continuously exposed to groundwater or surface water through percolation, run-off and/or groundwater saturation.

### 3.1 Contaminated Sewer Lines

Three contaminated sanitary sewer lines were encountered during recent ER accelerated actions. These are uranium in the sanitary sewer at Building 442, mercury in the sewer line at Building 441 and plutonium and americium in a sanitary drain at Building 779.

#### 3.1.1 Building 442 – IHSS Group 400-7

Building 442 was used as a laundry from 1953 to approximately 1972. The clothing laundered came from the garage, general maintenance and also from Building 444 where beryllium and depleted uranium components were manufactured. An accelerated action for most of IHSS Group 400-7, including the building and associated IHSSs, was completed in 2002. Information will be summarized in a closeout report when all the remaining actions are completed.

During the accelerated action, the sanitary sewer lines underneath the Building 442 slab were removed. A 6-inch cast iron sanitary sewer line ran from east to west and served as the main discharge from Building 442 to a manhole on 5th Street. Approximately five feet of the sewer line was removed outside of the building to more than 6' below grade to the point where cast iron pipe was joined to a 6-inch PVC pipe. Even though the cast iron was joined to PVC pipe with a dilapidated rubber boot, no soil contamination was present. The joint was most likely in poor condition when in use. These type of joints are susceptible to leaking and are generally no longer used in newer construction.

When the sewer line was cut in 2002, a sample was retrieved from inside the sewer line (Table 4). The solids contained elevated uranium at 4 nanoCuries/gram (nCi/g) and elevated semi-volatile compounds.

Table 4 Building 442 Sanitary Sewer Line Solids Analytical Results

Analyte	Concentration (Totals)	Units	Concentration (TCLP)	Units	Wildlife Worker AL (DOE 2003a)
Uranium 238	3,920	pCi/g	-		351 pCi/g
Uranium 235	114	pCi/g	-		8 pCi/g
Beryllium	52.4	mg/kg	-		921 mg/kg
Cadmium	200	mg/kg	246	ug/l	962 mg/kg
Chromium	1300	mg/kg	3	ug/l	268 mg/kg
Copper	2870	mg/kg	-		40900 mg/kg
Lead	2400	mg/kg	846	ug/l	1000 mg/kg
Nickel	1710	mg/kg	-		20400 mg/kg
Silver	408	mg/kg	0.54	ug/l	5110 mg/kg
Thallium	19.4	mg/kg	-		NA
Benzo (a) anthracene	5500	ug/kg	-		34900 ug/kg
Benzo (b) flouranthene	7900	ug/kg	-		34900 ug/kg
Benzo (k) flouranthene	7100	ug/kg	-		349000 ug/kg
Benzo (g,h,l) perylene	9300	ug/kg	-		NA
Benzo (a) pyrene	8200	ug/kg	-		3490 ug/kg

**Table 4 Building 442 Sanitary Sewer Line Solids Analytical Results (cont.)**

Bis (2-ethylhexyl) phthalate	3600	ug/kg	-	1970000 ug/kg
Chrysene	7400	ug/kg	-	3490000 ug/kg
Flouranthene	3700	ug/kg	-	27200000 ug/kg
Indeno (1,2,3-cd) pyrene	8500	ug/kg	-	34900 ug/kg
Phenanthrene	910	ug/kg	-	NA
Pyrene	4500	ug/kg	-	22100000 ug/kg
Acetone	380	ug/kg	-	102000000 ug/kg
2-butanone (MEK)	32	ug/kg	-	192000000 ug/kg

**Bold** – analytes above WRW ALs

- = analysis not performed

pCi/g = picocuries per gram

mg/kg = milligram per kilogram

ug/kg = micrograms per kilogram

MEK = methyl ethyl ketone

ug/l = micrograms per liter

As shown above, uranium, chromium, lead and benzo(a)pyrene were above WRW ALs in the solids within the pipe. The uranium is most likely a result of the laundry operations. Chromium may be a result of laundering contaminated laundry from B444 where chromic acid was used. Lead is possibly derived from the older plumbing in this building. The benzo(a)pyrene and other semi-volatile compounds detected are primarily polyaromatic hydrocarbons (PAHs) that are common in this area and are associated with asphalt, foundation sealant and cleaning supplies. Bis (2-ethylhexyl) phthalate, while not above action levels, is also known as dioctyl phthalate (DOP), and is most likely a result of spills during the filter testing at this facility.

The east (building) end of the PVC pipe was sealed with foam. The west end of the sewer line where it connects to the main line was previously plugged with cement grout at the manhole on 5th Street prior to building D&D at a depth to the sewer line of approximately 9 feet. About 30 feet of 6-inch sanitary sewer line that connected Building 442 to the main sewer line was sealed at both ends and left in place.

Another sanitary sewer line exited the warehouse section of the Building 442 slab, however, no contamination was detected within this segment. Most of the line was more than three feet below grade and, therefore, left in place. The remaining sections and clean-outs within the line were removed to below three feet and disposed of as sanitary waste. The main sewer lines on 5th Street and Central Avenue connecting to the Building 442 area were jetted as part of the 2000-2001 activities.

The Building 442 laundry was one of the first laundries at the site and was known to have discharged wastewater into the sanitary sewer with potentially radioactive contamination (see Table 3). Because it was active early in plant history, the discharge levels were most likely the highest that occurred. As described earlier, better practices were implemented over time that reduced the contaminant load to the sanitary sewer system. The remaining line is greater than 6 feet below grade and also plugged at both ends. For these reasons, the solids within this sewer line, if any, will not impact surface water or groundwater quality.

Because some contaminated material is left in place, the subsurface soil screen was performed for the solids as described in Attachment 5, Section 5.3 to RFCA (DOE, 2003a):

- **Screen 1** – Are the contaminant of concern (COC) concentrations below RFCA Table 3 Soil ALs for the WRW? No – uranium, chromium, lead and benzo (a) pyrene are above WRW ALs.
- **Screen 2** – Is there a potential for subsurface soil to become surface soil (landslides and erosion areas identified on Figure 1 of the RFCA Modification)? No, the contaminants have no potential to become surface soil because these are contained within a pipe, 6 feet or greater below grade and the pipe is grouted at both ends.

- **Screen 3** – Does subsurface soil contamination for radionuclides exceed criteria defined in RFCA Section 5.3 and Attachment 14? No, subsurface soil radiological contamination does not exceed the criteria in RFCA Attachment 5, Section 5.3.
- **Screen 4** – Is there an environmental pathway and sufficient quantity of COCs that would cause an exceedance of surface water standards? No, there isn't an environmental pathway sufficient to cause an exceedance of surface water standards in surface water. While groundwater may seep into and out of the pipe, the nearby groundwater wells show no elevated concentrations of the contaminants present in the pipe.

Based on the results of the screen, no accelerated action is necessary because there is neither an environmental pathway nor the potential for exposure. In addition, groundwater monitoring will continue after closure to evaluate potential impacts to surface water for the Site.

### 3.1.2 Building 441 – IHSS Group 400-8

During the accelerated action for IHSS Group 400-8, that included Building 441 slab removal, mercury was noted within the sanitary sewer and process waste lines. Building 441 was originally a laboratory but was converted to an office building in 1966. The mercury in the sanitary sewer and process waste lines was most likely derived from the laboratory operations, possibly because of a broken lab instrument such as a pressure gauge.

The mercury was primarily found in the pipe joints on both lines. The joints are slightly lower than the adjacent piping and tend to trap heavy liquids. The mercury was removed during pipe removal and dispositioned appropriately.

### 3.1.3 Building 779 – IHSS Group 700-7

During the accelerated action for IHSS Group 700-7, that included Building 779 slab removal, a contaminated sanitary sewer drain was found in the annex area. Building 779 was placed into service in 1965 and was primarily a research and development facility with minor production and plutonium recovery operations. The research and development activities included pyrochemical technology, coatings, plutonium and non-plutonium metallurgy, chemical plutonium recovery, and product physical chemistry. As noted in Table 3, there were several radioactive discharges to the sanitary sewer at this building.

As the slab was removed, the sanitary sewer line at this location was found to have previously broken, with the soil stained immediately adjacent to the break. Radiological surveys of the pipe indicated that radiological contamination was present on the outside of the pipe in the area of the break. Therefore, soil samples were collected from two depths at this location to characterize the potential contamination. The results were:

- Six inch interval underneath the slab: Americium-241 at 117.6 pCi/g; and
- Next lower six-inch interval: Americium-241 at 26.25 pCi/g.

Calculated plutonium 239/240 activities are 670 pCi/g and 150 pCi/g, respectively, based on a plutonium to americium ratio of 5.7.

Lateral extent of the contaminated soil is limited to the area adjacent to the drain, based on field screening samples that showed zero detectable activity 2 feet away from the drain in all directions and the limited lateral extent of the staining. This soil will be remediated as part of the accelerated action at this location.

### **3.2 Biosolids Data**

In addition to treated effluent, WWTF generates a solid waste stream, the biosolids (dewatered sludge from the filter press). Biosolids information is relevant since it is likely to be similar to residual solids that might be left in the lines. Biosolids are dispositioned as low-level waste at the Nevada Test Site (NTS). Analytical data for the biosolids are available from three sources:

- Data collected in support of the Site's NPDES permit and provisions of the biosolids regulations at 40 CFR 503;
- Data collected to support disposal of biosolids at the Nevada Test Site; and
- Data collected to support DOE Order 5400.5 to prove that the Site is not releasing radionuclides to the environment.

These data are available only for the past decade and show that the average contaminant concentrations are well below regulated levels. The radiological levels in the biosolids have dropped significantly over the years and the combined data show that since the early 1990s, only low levels of metals and radionuclides have been detected, with virtually no volatile organic compounds (KH, 2002). This information compares favorably with data compiled by the Sewage Subcommittee of the Interagency Steering Committee on Radiation Standards (ISCORS) showing that radionuclide concentrations in sewage sludge and ash nationwide are relatively low (Nuclear Regulatory Commission [NRC], EPA, 1999).

#### **3.2.1 NPDES Data**

Biosolid management is regulated by the Site's current NPDES permit and by provisions of the biosolids regulations at 40 CFR 503, including monitoring of metal concentrations. Information gathered in the past 10 to 12 years from this monitoring was compared to the current WRW action levels in the RFCA Action Level Framework (ALF) (DOE, et al, 2003). None of the results exceed the 40 CFR 503 limits and, with the exception of arsenic, the RFCA action levels. Table A-1 in Appendix A summarizes these results. While Environmental Protection Agency (EPA) regulations require one sample per year, several samples may be collected in a given year with the average provided in Table A-1. When only one sample was taken, the drying bed sampled is indicated. The notable zinc increase in 2002 is due to zinc orthophosphate now added to drinking water to prevent copper and lead corrosion. It is anticipated that residual materials in the sewer will be below these levels and likely far below action levels since the main lines will continue to be flushed (KH, 2002).

#### **3.2.2 NTS Data**

Between 1990 and 1994, extensive analysis of the RFETS sewage sludge was undertaken to satisfy the waste acceptance criteria at NTS. The results showed that the sewage sludge did not contain hazardous constituents and demonstrated that the waste was acceptable to NTS. Therefore, this material is dispositioned at NTS as low level waste.

Both SW846 methodology and Toxicity Characteristic Leaching Procedure (TCLP) analyses were reported. These data are shown in Tables A-2 and A-3 in Appendix A. While not appropriate for determining the need for a remedial action, these data were compared to soil action levels and were found to be significantly lower even though the sludge is more concentrated than solids found in the sanitary sewer system.

#### **3.2.3 DOE Order 5400.5 Sample Results**

DOE Order 5400.5 requires occasional sampling of the biosolids for plutonium, americium and uranium to ensure that the site is not releasing radionuclides to the environment. EPA has not

established radionuclide limitations for biosolids, so no standards are available for comparison. However, activities were compared to the current WRW action levels in RFCA (DOE, et al, 2003) and none of the results exceed RFCA action levels. The most recent results are presented in Table A-4 in Appendix A and show americium-241 at a maximum of 0.6 pCi/g, and plutonium-239 at a maximum of 0.9 pCi/g.

### 3.2.4 Summary of Biosolid Sample Data

Biosolid sample results are all well below the RFCA WRW action levels and indicate that materials transmitted through the RFETS sanitary sewer system within the last 12 years did not contain contaminants above the action levels. Because the constant flow of essentially clean sewage for several years tends to flush the sewer system, this information supports a no further accelerated action determination. While the flow of clean sewage may act to dilute older, more contaminated holdup, this material will be further evaluated as described in Section 4.2.1.

### 3.3 Influent Data

The influent to Building 995 was monitored routinely for total suspended solids and carbonaceous biochemical oxygen demand (CBOD5) required by the current NPDES permit. In addition, during the period 1993 to 2000, the influent was monitored for a variety of constituents. These data indicate that there were low levels of metals and radionuclides in the WWTF influent. However, with the exception of copper, zinc and mercury, all were well below surface water ALs. Analyses for various organic compounds were performed during this period, with only one detected compound, acetone. Table B-1 in Appendix B presents the influent radionuclide concentrations. Metals concentrations within the influent were very low and are reported in Table B-2 of Appendix B. The results for organic parameters are presented in Table B-3 of Appendix B.

Influent samples were collected recently at Building 990, the former equalization basin facility upstream of WWTF. Sanitary sewage flows from the north and south sides of RFETS, generally the former PA and the non-Protected Area, combined at Building 990 prior to flowing into the treatment plant. The results from four sampling events in 2002 and 2003 indicate that concentrations were generally consistent with the values shown in the tables cited above. One notable exception was that the recent introduction of zinc orthophosphate to control corrosion in the water distribution system resulted in elevated levels of zinc above action levels in the influent flows. The analyses at Building 990 on both the north and south side show zinc as high as 916 ug/l. Use of zinc orthophosphate will be discontinued when the water supply system closes.

The average concentration of copper and acetone were above the standards. After closure, it is unlikely that these would remain a problem. Acetone is unlikely to remain in the system because it is highly volatile. It is not clear whether copper was discharged to the system or whether it was from copper piping in the domestic water lines. However, if it was discharged to the system, this will be discontinued as the system is closed and it is unlikely that residual copper will remain in the lines, based on the discussion in section 2.3.1 about precipitates. Copper piping will be isolated from the sanitary sewer system prior to its closure.

Mercury is most likely a result of the mercury held up in the joints of the sanitary sewer lines associated with B441. These have since been removed. If mercury hold up is present in other building sanitary sewers, it either will be removed along with the pipelines during building demolition or immobilized when the lines are disrupted, breaking the pathway to surface water.

Additional recent transuranic radionuclide results from influent samples collected by CDPHE were slightly above surface water standards, possibly as a result of D&D activities (see section 2.3). However, as stated above, at closure the pathway to surface water from the lines will be disrupted, and exceedances are not anticipated. Therefore, current influent data support a no further accelerated action approach.



## 4.0 Proposed Approach

Based on the information presented, the PAC 000-500 sanitary sewer system is proposed as a no further accelerated action based on process knowledge and existing analytical data. In addition, Best Management Practices, described below, will be implemented to disrupt potential pathway to surface water.

### 4.1 No Further Accelerated Action Justification

A separate No Further Action Justification will be submitted. However, this document is anticipated to include the following information and lines of reasoning.

As discussed previously, the sanitary sewer lines including smaller lines, main lines and abandoned lines are not significant contaminant sources for the following reasons:

- Sanitary sewer lines and components associated with buildings will be removed to a depth of 3 feet below the final grade as stated in the Facility Disposition RSOP (DOE, 2000). These are predominately smaller lines and represent a large percent of the total length due to the number of lines beneath and around facilities. It should be noted that some sewer lines were connected to administrative buildings or other non-process buildings and were never associated with processes that could contaminate the lines.
- The main contaminant source to the sanitary sewer system was laundry waste that is no longer generated at the Site. Recent spills do not warrant accelerated actions. A number of historic spills have already been closed under the OU 1 CAD/ROD (DOE, 1997) or as No Further Accelerated Action sites. In many lines, residuals from laundry waste have been flushed through continued use of the lines.
- All of the major contaminant discharges to the sewer system happened prior to 1990 (see Table 3). There has not been a major incident since the February 1989 chromic acid spill. Significant quantities of sewage have likely been discharged through these lines since these incidents occurred. Much tighter controls over hazardous wastes, radionuclides and other potential contaminants were implemented in the 1980s and 1990s at RFETS greatly reducing the number of spills that could have impacted the sewer system as documented in the few incidents occurring in the 1990s (Section 2.2). Other measures were also taken including an intensive effort to label all drains and an evaluation of lines to ensure that they were separated from hazardous and radiological sources.
- Recent accelerated actions at Buildings 442 and 441 indicate that, when found, elevated contaminant concentrations within the sanitary sewer lines do not coincide with contamination in the adjacent soils, even when couplings and joints were significantly deteriorated. High concentrations are expected closest to their source, where the lines are most likely to be removed. Contaminants are often associated with traps, bends and joints that are within three feet of final grade and will be removed.
- Jetting of the main lines eliminated significant solids within the main lines. While no data were collected from the removed solids, the jetting equipment was not radiologically contaminated during the operations, indicating that significant levels of removable radioactivity are not present in the main system. Fixed contamination in the lines will not result in contamination release. As stated above, major contaminant discharges to the system no longer occur. Therefore, contamination of these lines after flushing is unlikely.
- Infiltration and inflow studies indicate that water leaks into the sanitary sewer system, and that exfiltration is minimal. Therefore, contamination in the soil along the sanitary sewer system is unlikely. This is due in part to most of the system being gravity flow rather than pressurized. Additionally, it is anticipated that even if the overall site water table rises

after Site Closure, the grouting at manholes will further isolate the residual sanitary sewer lines, eliminating these as a pathway.

- In recent years, a number of modifications have been made to prevent infiltration and, coincidentally, exfiltration of the sewer lines. Lines have been slip-lined to seal joints and other areas that could potentially leak.
- Biosolids are similar to residual solids that may remain in the sanitary sewer lines. Since the largest lines will be or have been flushed, there may only be negligible amounts in these lines. In lines that might not have been flushed, the amount could vary. However, the current biosolids data indicate that this material is not a risk to the environment.
- Current influent to the WWTF is well below surface water action levels except for acetone, copper, zinc and mercury (see Section 3.3). As noted, the likely sources of these materials will be discontinued, removed or disrupted prior to closure of the sanitary sewer lines. These influent concentrations indicate similar contaminant concentrations currently exist within the sanitary sewer lines. If higher contaminant concentrations are present but being diluted by the flow, isolation of the system as described above will prevent these from entering surface water.
- Large volumes of relatively clean water will continue to flush the system until the sanitary sewer system is closed. This has the effect of further reducing or eliminating contaminated solids within the system.

## 4.2 Proposed Path Forward

While the sanitary sewer system is not a contaminant source requiring an accelerated action, these lines could still be a significant pathway for groundwater flow to surface water through pipes and pipe bedding due to the large diameter of the pipes, wide extent across Site, and the proximity of downgradient segments to surface water. For these reasons, the Best Management Practices described below will be used to disrupt potential pathways to surface water.

Closure of the sanitary collection system is associated with the closure of Building 995. Flushing of the buildings and plugging of the lines will proceed as possible from the west to the east, with water to continue to be collected at Building 995 for as long as possible and preventing water from backing up within the pipes during decommissioning. A table will be included in the D&D Closeout Report for Building 995 showing the disposition of the collection system components including manholes and lift stations. Waste generated as part of the sanitary sewer system closure will be tracked according to type and volume and also reported in this closeout report.

### 4.2.1 Proposed Grab Sampling

In consultation with the Colorado Department of Public Health and Environment (CDPHE), it is proposed that one-time grab samples of solids be collected from the lines at locations shown on Figure 1. These samples would be analyzed for the radionuclides listed in Table 5. All samples will be grab samples and will be obtained from the material (solids) from inside the pipe. If samples cannot be collected from the identified manhole because of insufficient material, then additional manholes will be inspected in the nearby area, and if sufficient material is present, then a sample will be collected from that location. This sampling effort is presently ongoing.

Although efforts will be made to sample solids, samples could consist predominantly of material currently carried by the system. Therefore, the contaminant levels might be more representative of materials currently being added to the line rather than solids due to scaling or other types of deposits on the pipe wall. Because this material is not environmental media, no Industrial Area Sampling and Analysis Plan (IASAP) Addendum is required.

**Table 5 List of Analytes for Proposed Grab Samples from Sanitary Sewer System**

Analytes
Americium 241
Plutonium 239, 240
Uranium 233, 234
Uranium 235
Uranium 238
Metals analytical suite

Additional best management practices may be proposed for a given line segment based on the analytical results, depth and the potential for remaining holdup within the lines to impact surface water.

#### **4.2.2 Best Management Practices Proposed at Manholes, Cleanouts and Utility Trenches**

Manholes are located approximately every 200 feet along the main sanitary sewer lines. The proposed approach is to:

- Perform radiological surveys of the inlets and outlets prior to grouting. This will consist of taking swipes, drying them, and then counting the swipes. Counts above 5,000 dpm beta and 1,000 dpm alpha will be further evaluated (after allowing potential radon to decay).
- Plug and grout inlet and outlets. Plug thickness depends on the pipe diameter but is expected to be 9-inches to 1-foot thick.
- Add grout, flowable fill, bentonite or concrete to a depth of about one foot or until the inlets and outlets are covered with approximately 1 foot of material.
- Remove the part of the manhole within 3 feet of current or final grade. Removed materials will be placed back into the manhole if these meet radiological criteria, or appropriately dispositioned if these do not.
- Remainder of the structure will be backfilled with soil, grout or similar materials to the greater of current or final grade. The upper 3 feet will be backfilled with soil to facilitate plant growth.

These actions will result in isolating 200 foot-long segments of the sanitary sewer lines and will effectively eliminate the potential for a pathway to exist to surface water. Figure 2 illustrates the process proposed at the manholes to eliminate the pathway to surface water. The specific details will be included in the appropriate work control document and not in this document. Where possible, the grouting will take place from upgradient to downgradient to minimize the potential to build up water in the remaining lines.


Cleanouts will be removed that are within 3 feet of grade. The openings will be plugged and grouted, then the excavation will be backfilled with dirt.

Disruption of the utility trenches associated with the sanitary sewer system will occur at two places to further reduce east west flow of groundwater through or around the sanitary sewer lines:

- 700 Area where the alluvium thins over an apparent bedrock high; and
- 800 Area north of the locations of B865/886 along Central Avenue.

**Figure 2 Best Management Practices at Manholes**

### Typical Manhole

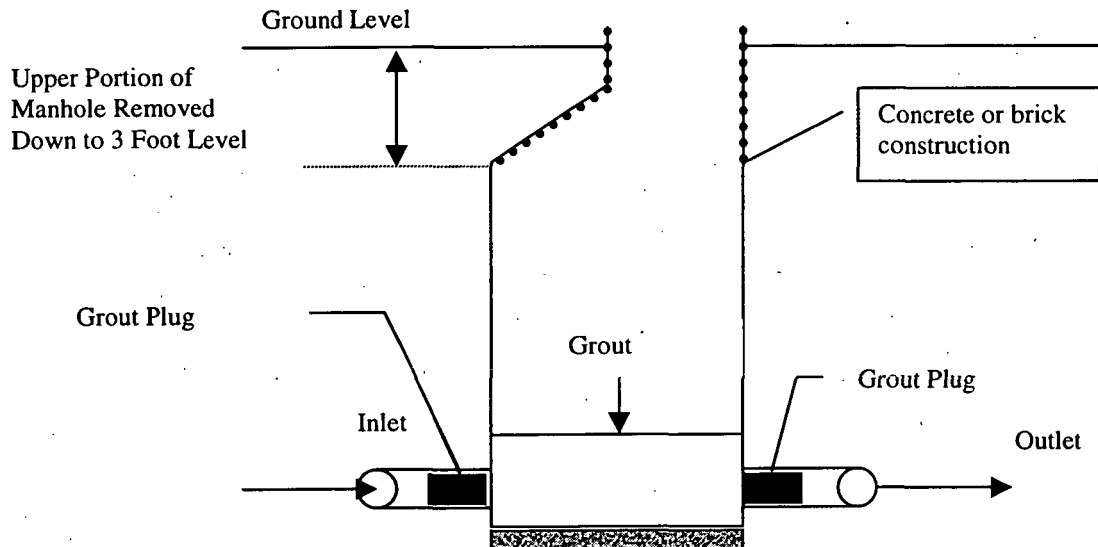

Disruption will consist of either excavating the main utility trench, removing the existing sanitary sewers and other associated utilities, and backfilling the excavation with more impermeable material, or grouting or similarly reducing the permeability of the subsurface material. Specific details on how this will be accomplished will be determined during project planning, and not as part of this document.

Other areas were or will be disrupted as part of plant closure and also act to reduce the flow of groundwater. These are:

- South of B881 where the sanitary sewer lift station was removed and backfilled.
- West of the WWTF where sanitary sewer lines will be removed, the bedding material disrupted and the excavations backfilled (see Section 4.2.4).
- North of B771 where the sanitary sewer lift station was abandoned in place and the area will be backfilled, reducing the potential for groundwater to reach surface water.
- Much of the sanitary sewer line south and west of B371 was removed during the land reconfiguration activities, significantly reducing the potential for groundwater collection in the sanitary sewer.

#### 4.2.3 Best Management Practices at Lift Stations

Sewer lift stations at Buildings 881, 771 and other deep buildings are anticipated to be removed during building decommissioning. If not removed at this time, these will be removed to a depth of

at least 3 feet below grade as a Best Management Practice. Additional lift stations are present throughout the Site. These range in depth from about 8 feet to 24 feet below grade. Where lift stations are removed, the following process will be followed.

- The sewer lines entering the lift stations will be removed where within three feet of the greater of current or final grade and the ends grouted.
- Bedding materials under the piping will be disrupted with grout or by removing the permeable material and replacing it with fill or native materials.
- The lift station excavation will be backfilled with low permeability material to eliminate the pathway to surface water.

If not removed, lift stations will be abandoned in a similar manner as manholes as follows:

- Remove pumps and associated equipment.
- Plug and grout inlet and outlets. Perform radiological surveys of the inlets and outlets prior to grouting. Counts above 5,000 dpm beta and 1,000 dpm alpha will be further evaluated (after allowing potential radon to decay).
- Bentonite grout, concrete or similar materials will be poured into the manhole to a height above the inlet and outlet piping.
- Remove part of structure within 3 feet of current or final grade, whichever is greater. Removed materials will be placed back into the structure into the manhole if these meet radiological criteria, or appropriately dispositioned if these do not.
- Backfill with soil, grout or similar materials to the greater of current or final grade. The last three feet of backfill will be soil to facilitate plant growth.
- Where lift stations are not located in areas where there is potential to impact surface water, the fill material around the sewer lines will not require disruption.
- Where lift stations are located in areas where there is potential to impact surface water, the fill material around the sewer lines will require disruption, either by removal of the permeable fill in areas near the lift station and backfill with low permeability backfill, or by injection of grout or similar materials.

#### **4.2.4 Best Management Practices at WWTF**

The WWTF Decommissioning Project will characterize and remove all WWTF structures to a depth of three feet below final grade. About half of the WWTF buildings are classified as "anticipated" Type 1 RFCA facilities and the other half are classified as "anticipated" Type 2 RFCA facilities. A Reconnaissance Level Characterization Report (RLCR) has been submitted to the State for the "anticipated" Type 1 RFCA facilities (i.e., Area 5-Group 16 facilities). Since the facilities were still in use and the Site couldn't survey all of the in-use trenches, etc. inside the building, this report was not approved. Once the WWTF is shutdown, the Site will survey areas previously in use and resubmit the RLCR.

The pathway to surface water in this area will be eliminated using similar methods as described above. In accordance with the Facility Disposition RSOP, all lines within three feet of the final grade will be removed and the ends plugged. In addition, at this location, a Best Management Practice will be implemented to disrupt the bedding material for removed sanitary sewer lines. Disruption will be either by physically removing the bedding material and replacing this with fill dirt or native materials, or by adding bentonite, grout or other impermeable materials.

#### **4.2.5 Abandoned Sanitary Sewer Lines**

Abandoned lines are no longer part of the active sanitary sewer system. Recently abandoned lines were flushed and plugged with grout, either at the manhole or where the line was cut. Older lines were isolated from the system.

The expected abandoned lines are shown on Figure 1. However, the number of abandoned sanitary sewer lines cannot be quantified. Some of the lines believed to be abandoned were either previously removed or never existed. Some reportedly abandoned lines are based on design drawings that were never implemented, erroneous reports, maps showing an existing line in the wrong location, etc.

For example, what was thought to be an abandoned sanitary sewer line running to Building 991 was determined not to exist based on interviews with Site personnel. And as the active sanitary sewer lines were being disconnected at Buildings 551 and 334 where abandoned lines were expected to exist, evidence of utility trenches were found along with some broken tile, but the sanitary sewer pipe was no longer present.

Because of the uncertainty, the following approach will be used:

- Known abandoned lines will be removed to a depth of three feet below final grade and the remaining ends plugged. Any remaining manhole on an abandoned line will be dispositioned as described in Section 4.2.1.
- Abandoned lines associated with Building 980 and other 900 area buildings are not well located; however, these tie into a manhole on the main sewer line. These lines will be dispositioned as described in Section 4.2.1 along with the associated manhole.
- Sanitary sewer lines discovered during demolition or an accelerated action will be removed to a depth of 3 feet below final grade with the remaining ends plugged.
- Potential sanitary sewer lines that cannot be confirmed as existing will not be pursued. Because of the other measures taken, additional effort to locate these lines, if present, is not warranted.

#### **5.0 Conclusions and Recommendations**

Based on existing information from the previously no-further-accelerated-action (NFAA) determinations for sanitary sewer waste spills, no additional characterization or accelerated action is required for the soils associated with the sanitary sewer lines. Additional characterization or remediation might be performed in accordance with the ER RSOP for Routine Soil Remediation for sanitary sewer segments associated with the individual IHSS Groups. These will be defined in the specific ER RSOP notification for the individual IHSS Group.

A NFAA document will be generated documenting this information in the appropriate format in accordance to RFCA requirements and submitted for regulatory agency approval.

Samples will be collected from within the sanitary sewer system at locations agreed upon through the consultative process with the regulatory agencies. These sample results will be used to determine if additional best management practices will be performed at given line segments.


A Sanitary Sewer Best Management Practice Field Implementation Plan Addendum or other work control document will be generated as needed to document the actions to eliminate the potential pathway to surface water. Because no decision document is required to implement these Best Management Practices, the scope can be performed where and when access is available.

Work is expected to be initiated in the south and west sides of the Site first, most likely first in the area where the 893 trailers were previously located. In consultation with CDPHE, a contact record was generated that details the salient points of this strategy as it applies to this area so that work can be initiated prior to completion of this strategy.

At Site closure, the main sewer lines will be a series of pipe segments that are below three feet and plugged at both ends further interrupted by grouted manholes. Figure 3 shows the impediments to flow to surface water once Best Management Practices have been implemented.

Groundwater monitoring of the Site will continue after closure and will be used to indicate if additional actions are necessary, whether at the sanitary sewer system, or elsewhere on Site.

Figure 3 Impediments to Flow in Sanitary Sewer System

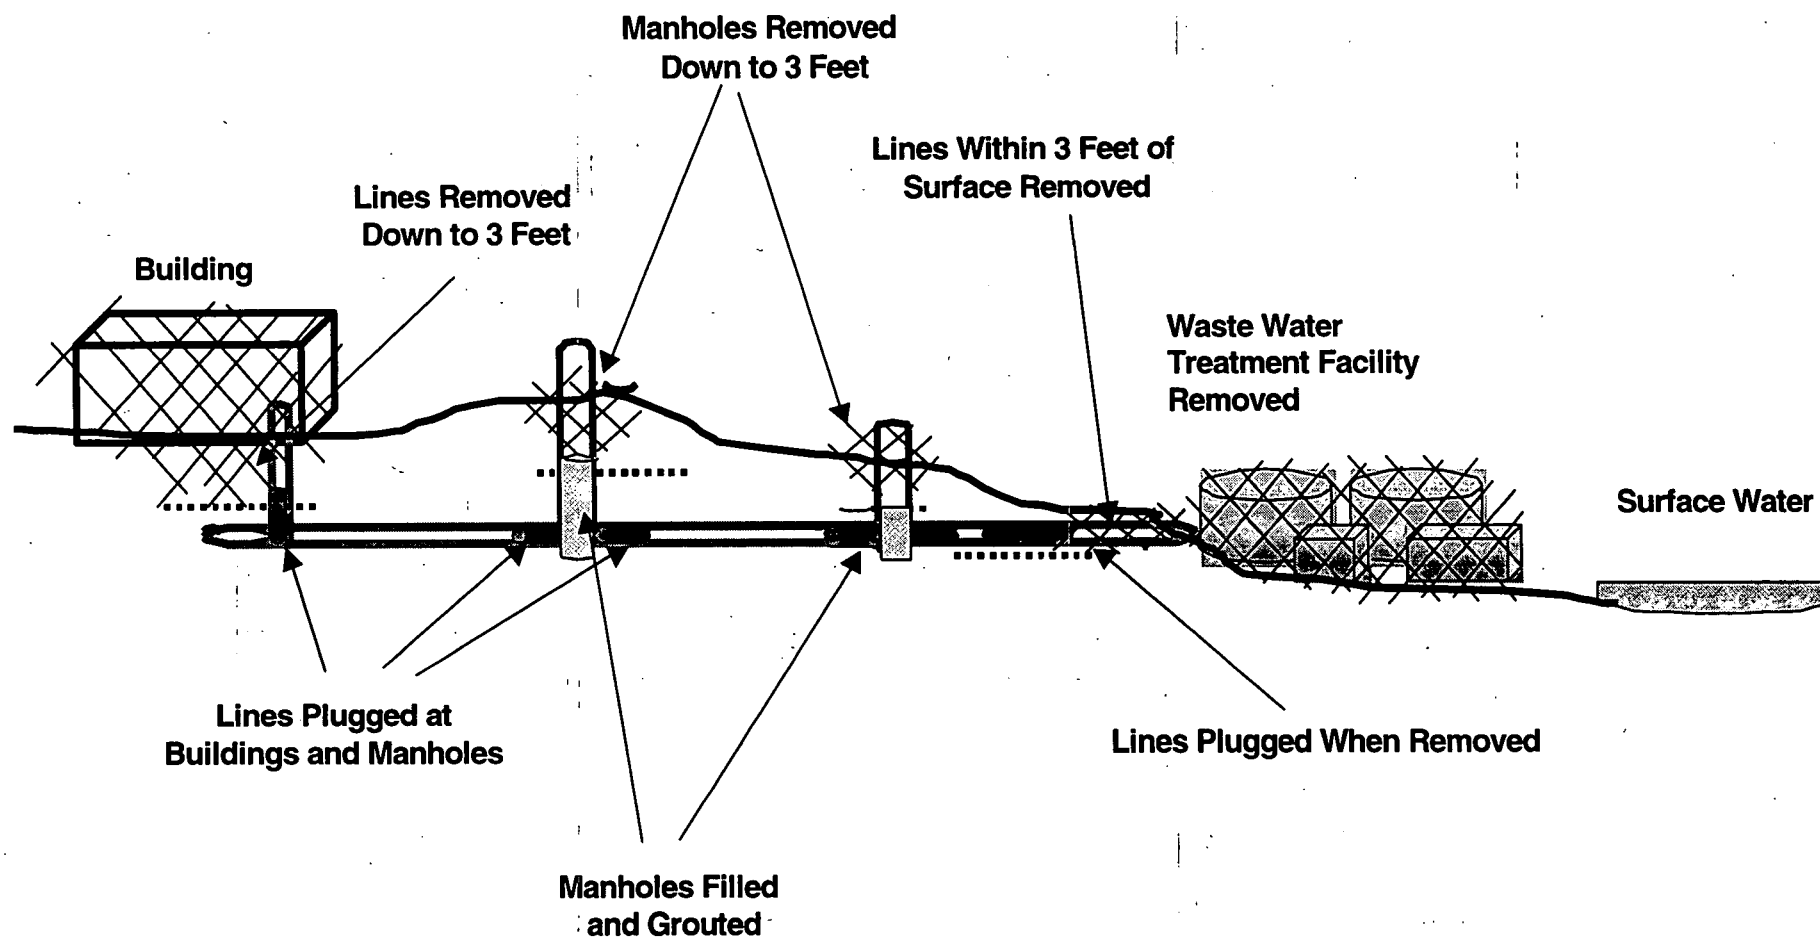



## 6.0 References

Advanced Sciences, Inc. (ASI) 1991, Zero-Offsite Water-Discharge Study Task 1: Sanitary Sewer Infiltration/Inflow and Exfiltration Study, Rocky Flats, Golden, Colorado.

DOE, 1992, Historical Release Report for the Rocky Flats Plant, Rocky Flats Plant, Golden, Colorado.

DOE, 1997, OU 1 Corrective Action Decision /Record of Decision, Rocky Flats Environmental Technology Site, Golden, Colorado, February.

DOE, 1999, Annual Update, Historical Release Report, Rocky Flats Environmental Technology Site, Golden, Colorado, September.

DOE, 2000, Facility Disposition RFCA Standard Operating Protocol, Rocky Flats Environmental Technology Site, Golden, Colorado.

DOE, 2001, 1999/2000 Sanitary Sewer Manhole Inventory, Pipe Cleaning, and Video Inspection, Rocky Flats Environmental Technology Site, August 6.

DOE, 2002a, Annual Update, Historical Release Report, Rocky Flats Environmental Technology Site, Golden, Colorado, August.

DOE, 2002b, Evaluation Of Infiltration And Inflow At The Rocky Flats Environmental Technology Site Wastewater Treatment Plant, Building 995, Rocky Flats Environmental Technology Site, Golden, Colorado.

DOE, 2003a, Environmental Restoration RFCA Standard Operating Protocol for Routine Soil Remediation, Modification 1, Rocky Flats Environmental Technology Site, Golden, Colorado, September.

DOE, 2003b, Evaluation Of Infiltration And Inflow At The Rocky Flats Environmental Technology Site Wastewater Treatment Plant For Calendar Year 2002, Rocky Flats Environmental Technology Site, Golden, Colorado.

DOE, CDPHE, and EPA, 2003, Modifications to the Rocky Flats Cleanup Agreement, Rocky Flats Environmental Technology Site, Golden, Colorado, April.

KH, 2002, Rocky Flats Annual Sewage Sludge Report, Rocky Flats Environmental Technology Site, Golden, Colorado.

NRC, EPA, 1999, Joint NRC/EPA Sewage Sludge Radiological Survey: Survey Design and Test Site Results, EPA 832-R-99-900, May.

Michael Vess, 2003, Personal Communication, April.

## Appendix A - Biosolids Data

### A.1 NPDES Data

This data was collected as part of biosolids management under the Site NPDES Permit.

**Table A-1 Summary of Metals Results for Site Biosolids – 1993 to 2002 (in mg/kg)**

	Arsenic	Cadmium	Chromium VI	Copper	Lead	Mercury	Molybdenum	Nickel	Selenium	Zinc
1993 (avg)	11	12.7	68	N/A	74.3	2.02	N/A	N/A	7	N/A
1994 (avg)	8.3	17.8	74.3	559	78.9	N/A	N/A	25.3	4.1	1404
1995 (avg)	23.21	10.26	63.1	543	69.66	26.5	20.85	30.48	11.34	1474.13
1996 (avg)	29.93	10.87	44.8	337.33	72.73	7.73	9.1	16.53	10.63	840
1997 (avg)	6	13.7	51.6	683.7	91.3	8.2	17.6	25.9	6.6	1688
1998 (Bed 7)	16.1	28.6	125	775	109	5.4	17.8	30.8	8.2	1870
1999 (avg)	7.85	9.9	37.5	896	66.95	7.25	24.55	24.05	9.65	2170
2000 (avg)	4.76	3.75	48.8	470	59.7	4.715	15.15	52.95	2.986	855
2001 (Bed 1)	5.9	8.2	107	571	101	10.5	13.6	45.9	6.7	3610
2002 (Bed 3)	6.8	12	62	770	87	10	14	67	7.1	6300
2003	2.9	5.3	27	380	31	12	8.6	14	5.9	5400
Average (11 year)	11.2	12.1	64.5	598.5	76.5	9.4	15.7	33.3	7.3	2561.1
40 CFR 503 Monthly Avg Limit	41	39	-	1500	300	17	N/A	420	100	2800
WRW AL	22.2	962	268	40900	1000	25200	5110	20400	5110	30700

N/A=Not applicable

### A.2 NTS Data

This data was collected to demonstrate that biosolids met the waste acceptance criteria at the NTS.

**Table A-2 Biosolid NTS Waste Acceptance Criteria Results – Radionuclides**

Radionuclides	Activity (pCi/g)	WRW AL
Gross alpha	29.516	N/A
Gross beta	25.194	N/A
Uranium 233/234	11.864	300
Uranium 235	0.422	8
Uranium 238	5.029	351
Plutonium 239/240	2.824	50
Americium 241	0.731	76

N/A=Not applicable

**Table A-3 Biosolid NTS Waste Acceptance Criteria Results – Metals and Organics**

Analyte	Total (mg/kg)	TCLP (mg/l)	WRW AL For Soil (mg/kg)
Arsenic	11.00	ND	22.2
Barium	404.00	0.217	26400
Cadmium	12.69	0.009	962
Chromium VI	67.97	0.007	268
Lead	74.34	0.036	1000
Mercury	2.02	ND	25,200
Selenium	7.02	ND	5,110
Silver	130.44	0.004	5,110
1,1,1-Trichloroethane	0.0102	ND	79,700
1,1,2-Trichloroethane	ND	ND	236
1,1-Dichloroethene	ND	ND	17
1,2-Dichlorobenzene	ND	ND	31,200
1,2-Dichloroethane	ND	ND	106
1,4-Dichlorobenzene	ND	ND	840
2,4,6-Trichlorophenol	ND	ND	3,470
2,4-Dinitrotoluene	ND	ND	56,300
2-Butanone	0.126	0.029	192,000
2-Methylphenol [o-Cresol]	ND	ND	N/A
3-Methylphenol [M-Cresol]	ND	ND	N/A
4-Methylphenol [P-Cresol]	0.848	ND	N/A
Total Cresols	ND	ND	N/A
4-Methyl-2-pentanone	0.02	ND	16,400
Acetone	ND	0.41	102,000
Benzene	ND	ND	205
Carbon disulfide	0.015	0.011	15,100
Carbon tetrachloride	ND	ND	81.5
Chlorobenzene	ND	ND	6,090
Chloroform [Trichloromethane]	ND	0.011	19.2
Ethylbenzene	0.0107	ND	4,250
Ethyl Ether	ND	ND	N/A
Hexachlorobenzene	ND	ND	17.2
Hexachlorobutadiene	ND	ND	147
Hexachloroethane	ND	ND	737
Methylene chloride [Dichloromethane]	ND	ND	2,530
Nitrobenzene	ND	ND	332
Pentachlorophenol	ND	ND	162
Tetrachloroethene	ND	ND	615
Toluene	0.014	0.011	31,300
Trichloroethene	ND	ND	196
Vinyl chloride	ND	ND	412
Xylene (total)	0.01	ND	1,000,000

ND = Not Detected

### A.3 DOE Order 5400.5 Data

This data was collected to meet the requirements of DOE Order 5400.5, which requires that the biosolids be occasionally sampled for plutonium, americium, and uranium.

**Table A-4 Summary of Radionuclides Results and Comparison to RFCA WRW Action Levels**

Analyte	2001	2002	RFCA WRW AL	Units
Americium 241	0.5	0.6	76	pCi/g
Plutonium 239	0.7	0.9	50	pCi/g
Uranium 234	12.0	8.3	300	pCi/g
Uranium 235	0.4	0.9	8	pCi/g
Uranium 238	14.2	10.7	351	pCi/g

## Appendix B – Building 995, Sewage Treatment Plant Influent Data

The influent to Building 995 is the incoming untreated sewage so it consists of everything that flows through the sanitary sewer system. The data presented below was collected between 1993 and 2000.

**Table B-1 Summarized Radionuclide Results for WWTF Influent**

Analyte	Average Activity (pCi/l)	Number of Samples	Surface Water Standard (pCi/l)
Uranium 235	0.041	38	10*
Uranium 238	1.097	38	10*
Plutonium	0.032	38	0.15
Americium	0.016	38	0.15
Gross Alpha	1.496	702	11
Gross Beta	10.008	721	19

\* Total uranium value

**Table B-2 Summarized Metal Results for WWTF Influent**

Analyte	Average Conc. ug/L	Number of Samples	Surface Water Standard (ug/L)
Arsenic	3.65	27	50
Cadmium	0.62	27	1.5
Chromium	3.41	28	50
Copper	39.92	30	16
Lead	4.74	27	6.5
Mercury	0.15	22	0.01
Molybdenum	17.90	26	N/A
Nickel	5.01	27	123
Selenium	2.00	27	5
Zinc	152.58	26	141

**Table B-3 Summarized Organic Results for WWTF Influent**

Analyte	Average Conc. ug/L	Number of Samples	Surface Water Standard (ug/l)
1,1,1-Trichloroethane	ND	35	200
1,1,2,2-Tetrachloroethane	ND	35	2.1
1,1,2-Trichloroethane	ND	35	3
1,1-Dichloroethane	ND	35	3,650
1,2-Dichloroethene	ND	35	70
1,2-Dichloropropane	ND	35	0.52
2-Butanone	ND	35	21,900
2-Hexanone	ND	35	-
Acetone	157.06	36	3,650
Benzene	ND	35	1.2
Bromodichloromethane	ND	35	0.56
Bromoform	ND	35	4.3
Bromomethane	ND	35	48
Carbon Disulfide	ND	35	3,650
Carbon Tetrachloride	ND	35	0.25
Chloroethane	ND	35	29.4
Chloroform	ND	35	5.7
Chloromethane	ND	35	5.7
Dibromochloromethane	ND	35	80
Methylene Chloride	ND	35	4.7
Tetrachloroethene	ND	35	0.8
Total Xylenes	ND	35	10,000
Trichloroethene	ND	35	2.7
Vinyl Chloride	ND	35	2.00

ND = Not Detected

**ATTACHMENT 2  
REGULATORY CONTACT RECORDS**

55-

## ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE ER REGULATORY CONTACT RECORD

---

**Date/Time:** 10-21-03/ 1:00  
**Site Contact(s):** Annette Primrose  
**Phone:** 303 966-4385  
**Regulatory Contact:** David Kruchek  
**Phone:** 303 692-3328  
**Agency:** CDPHE

---

**Purpose of Contact:** Removal of Sewer Manholes

---

### **Discussion**

Two sanitary sewer manholes will be removed during demolition and regrading of the B116, T117A area. These manholes are part of the sanitary sewer system (PAC 000-500), however, these are not associated with spills or releases to the system. These manholes are on the end of the sewer lines that begins under T117A and runs northeast to the Sage Avenue.

The manholes will be removed as follows

- The lines will be plugged and grouted at the manhole,
- Top 3 to 4 feet of the structure will be removed, and
- Remaining structure will be backfilled.

These sewer lines were previously flushed prior to building demolition.

---

**Contact Record Prepared By:** Annette Primrose

---

### Required Distribution

S. Bell, RFFO  
J. Berardini, K-H  
L. Brooks, K-H ESS  
M. Broussard, K-H RISS  
L. Butler, K-H RISS  
G. Carnival, K-H RISS  
N. Castaneda, RFFO  
C. Deck, K-H Legal  
R. DiSalvo, RFFO  
S. Gunderson, CDPHE

M. Keating, K-H RISS  
G. Kleeman, USEPA  
D. Kruchek, CDPHE  
D. Mayo, K-H RISS  
R. McCalister, DOE  
J. Mead, K-H ESS  
S. Nesta, K-H RISS  
L. Norland, K-H RISS  
K. North, K-H ESS  
E. Pottorff, CDPHE

A. Primrose, K-H RISS  
T. Rehder, USEPA  
S. Serreze, RISS  
D. Shelton, K-H  
C. Spreng, CDPHE  
S. Surovchak, RFFO  
K. Wiemelt, K-H RISS  
C. Zahm, K-H

Additional Distribution  
(choose names as applicable):





## ER REGULATORY CONTACT RECORD

**Date/Time:** March 17, 2004/12:30

**Site Contact(s):** Annette Primrose, Karen Wiemelt, Cameron Freiboth, Steve Nesta  
**Phone:** 303 966-4385 303 966-9883 303 966-2823 303 966-6386

**Regulatory Contact:** David Kruchek  
**Phone:** 303 692-3328

**Agency:** CDPHE

**Purpose of Contact:** Closure of Sanitary Sewer in the Contractor Yard area

### Discussion

At the weekly RISS Integration Meeting, the approach for closing the sanitary sewer in the Contractor Yard was discussed. A map showing the sanitary sewer lines, 14 manholes and 2 lift stations in this area was provided along with a brief discussion on how each would be dispositioned.

The approach agreed upon for this area is, in summary:

- Remove all pipelines and structures that are within 3 feet of current or proposed future ground surface, whichever is lower, along with other collocated infrastructure
- Perform radiological surveys of the inlets and outlets for manholes and lift stations. Additional actions may be required as a result of these surveys.
- Plug and grout any open ends of the sanitary sewer lines, along with the inlets and outlets at manholes and lift stations.
- Grout and backfill the manholes and lift stations to the current or proposed future ground surface, which ever is greater

**Contact Record Prepared By:** Annette Primrose

### Required Distribution:

M. Aguilar, USEPA  
S. Bell, DOE-RFFO  
J. Berardini, K-H  
B. Birk, DOE-RFFO  
L. Brooks, K-H ESS  
M. Broussard, K-H RISS  
L. Butler, K-H RISS  
G. Carnival, K-H RISS  
N. Castaneda, DOE-RFFO  
C. Deck, K-H Legal  
S. Gunderson, CDPHE  
M. Keating, K-H RISS  
G. Kleeman, USEPA  
D. Kruchek, CDPHE  
D. Mayo, K-H RISS

R. McCallister, DOE-RFFO  
J. Mead, K-H ESS  
S. Nesta, K-H RISS  
L. Norland, K-H RISS  
K. North, K-H ESS  
E. Pottorff, CDPHE  
A. Primrose, K-H RISS  
R. Schassburger, DOE-RFFO  
S. Serreze, K-H RISS  
D. Shelton, K-H ESS  
C. Spreng, CDPHE  
S. Surovchak, DOE-RFFO  
K. Wiemelt, K-H RISS  
C. Zahm, K-H Legal

### Additional Distribution:

John Stover, DOE  
Joe Lucerna, K-H RISS  
Robert Fiehweg, K-H RISS  
Gary Morgan, DOE  
Edgar Ethington, CDPHE

## ER REGULATORY CONTACT RECORD

**Date/Time:** May 4, 2004/12:30

**Site Contact(s):** Annette Primrose  
**Phone:** 303 966-4385

**Regulatory Contact:** David Kruchek  
**Phone:** 303 692-3328

**Agency:** CDPHE

**Purpose of Contact:** Closure of Sanitary Sewer in Various D&D Areas

### Discussion

In preparation for Site closure and in association with building demolition, sanitary sewer lines in the B111/119 area, B121/122, B750, B559 and B887 areas need to be dispositioned in the immediate future. The general approach for all of these is stated below followed by the project specifics.

#### B111, 119, 121 and 122

- Sewer lines from buildings 111 and 119 were previously flushed. Remaining lines will be flushed at the buildings and manholes.
- Check Manholes (MH) -10, 13, 14, and 16 for sediment and collect a sample for radiological and metals analysis if possible at the best location.
- At MH-21, -17, -18, -16, and -10, the inlets and outlets will be plugged and grouted. Plug thickness depends on the pipe diameter but is expected to be 9" to 1 foot thick. Add grout, flowable fill, or bentonite to a depth of about one foot or until the inlets and outlets are covered with approximately 1 foot of material. Remove part of manhole within 3 feet of current or final grade. Removed materials will be placed back into the manhole. Remainder of the structure will be backfilled with dirt, grout or similar materials to the greater of current or final grade. The upper 3 feet will be backfilled with dirt.
- At MH-20 and -14, plug and grout the west entrances only as the rest of the sanitary sewer line is active. No other work will be done at this time.
- MH-13 will be destroyed during D&D of B122. The remaining opening will be plugged and grouted at that time.
- Remove all cleanouts (CO) along this same line that are within 3 feet of grade. Plug and grout the openings and backfill with dirt.

#### B750 Area

- Check MH-100 and -103 for sediment and collect a sample for radiological and metals analysis, if possible.
- Flush sanitary sewer lines from the building.
- Remove cleanouts on the west side that are within 3 feet of current or final grade. Plug section that comes out of the building, if possible. Plug the remaining opening of the cleanout and backfill with dirt.
- Plug the east entrance at MH-103 and the south entrance at MH-100. No other work at this time as the remaining sanitary sewer line in this area is active.

#### B559 Area

- Check MH-136 and -211 for sediment and collect a sample for radiological and metals analysis, if possible.
- Flush sanitary sewer lines from the building.
- Remove portions of the cleanout on the north side of 559 that are within 3 feet of current or final grade. Plug the remaining opening of the cleanout and backfill with dirt.

- One area near the northeast corner of the building will be excavated to air gap and plug the lines where no manhole is present.
- MH-97, -136 and -211 will be removed as described above if this does not impact operation of the sanitary sewer system for other buildings.

#### B881/887 Area

- The lines have already been flushed in this area.
- The manhole immediately west of the lift station (MH-139) is still intact but is excavated to a depth of 5 or 6 feet. The inlets and outlets to this manhole were not previously plugged, however, the southern entrances to MH-138 was plugged, isolating this section of the sanitary sewer.
  - If not removed entirely, the manhole structure will be grouted as possible to seal off the inlet and outlet, then removed at the current excavated depth.
  - If removed entirely, then the exposed pipe will be plugged and grouted prior to backfill.
- Lift station 7 (LS-7)
  - A sediment sample will be collected from within the lift station, if possible, for radioactive and metals analysis.
  - Remove pumps and associated equipment.
  - Plug and grout inlet and outlets. Perform radiological surveys of the inlets and outlets prior to grouting.
  - Bentonite grout, concrete or similar materials will be poured into the lift station to a height above the inlet and outlet piping.
  - Remove part of structure within 3 feet of current or final grade, whichever is greater.
  - Removed materials will be placed back into the structure.
  - Backfill with dirt, grout or similar materials to the greater of current or final grade. The backfill material that is within 3 feet of final grade will be dirt.
  - Because the lift station is not located in an area where there is potential pathway to surface water, and because the sanitary sewer lines are not located where these can act as a conduit to surface water, the fill material around the sewers will not require disruption.
  - The outfall area for the overflow line leading to the south will be sampled if not previously sampled. The part of the overflow line within three feet of the greater of current or final grade will be removed, the end plugged and grouted as above, and backfilled with dirt. When the line is removed, the bedding material around it, if any, will be disrupted.

**Contact Record Prepared By: Annette Primrose**

#### Required Distribution:

M. Aguilar, USEPA  
S. Bell, DOE-RFFO  
J. Berardini, K-H  
B. Birk, DOE-RFFO  
L. Brooks, K-H ESS  
M. Broussard, K-H RISS  
L. Butler, K-H RISS  
G. Carnival, K-H RISS  
N. Castaneda, DOE-RFFO  
C. Deck, K-H Legal  
S. Gunderson, CDPHE  
M. Keating, K-H RISS  
G. Kleeman, USEPA  
D. Kruchek, CDPHE  
D. Mayo, K-H RISS

R. McCallister, DOE-RFFO  
J. Mead, K-H ESS  
S. Nesta, K-H RISS  
L. Norland, K-H RISS  
K. North, K-H ESS  
E. Pottorff, CDPHE  
A. Primrose, K-H RISS  
R. Schassburger, DOE-RFFO  
S. Serreze, K-H RISS  
D. Shelton, K-H ESS  
C. Spreng, CDPHE  
S. Surovchak, DOE-RFFO  
K. Wiemelt, K-H RISS  
C. Zahm, K-H Legal

#### Additional Distribution:

John Stover, DOE  
Joe Lucerna, K-H RISS  
Robert Fiehweg, K-H RISS  
Gary Morgan, DOE  
Edgar Ethington, CDPHE

60

## ER REGULATORY CONTACT RECORD

**Date/Time:** May 5, 2004/4:45

**Site Contact(s):** Annette Primrose  
**Phone:** 303 966-4385

**Regulatory Contact:** David Kruchek  
**Phone:** 303 692-3328

**Agency:** CDPHE

**Purpose of Contact:** Closure of Sanitary Sewer at B991 and T883

### **Discussion**

#### **B991**

As discussed and agreed, a sample is to be collected for radiological and metals analyses from the sanitary sewer line immediately east of B991 as the two manholes present east of the building are removed. These lines and manholes were previously flushed.

After sample collection, a grout plug approximately 12 inches thick is to be placed into the open end of the sanitary sewer line and the area will be backfilled.

#### **T883 Area**

The inlet and outlet to the manhole located due west of the 883 trailers is to be plugged and grouted. No additional work will occur at this time.

**Contact Record Prepared By:** Annette Primrose

### Required Distribution:

M. Aguilar, USEPA  
S. Bell, DOE-RFFO  
J. Berardini, K-H  
B. Birk, DOE-RFFO  
L. Brooks, K-H ESS  
L. Butler, K-H RISS  
G. Carnival, K-H RISS  
N. Castaneda, DOE-RFFO  
C. Deck, K-H Legal  
S. Gunderson, CDPHE  
M. Keating, K-H RISS  
G. Kleeman, USEPA  
D. Kruchek, CDPHE  
D. Mayo, K-H RISS

R. McCallister, DOE-RFFO  
J. Mead, K-H ESS  
S. Nesta, K-H RISS  
L. Norland, K-H RISS  
K. North, K-H ESS  
E. Pottorff, CDPHE  
A. Primrose, K-H RISS  
R. Schassburger, DOE-RFFO  
S. Serreze, K-H RISS  
D. Shelton, K-H ESS  
C. Spreng, CDPHE  
S. Surovchak, DOE-RFFO  
K. Wiemelt, K-H RISS  
C. Zahm, K-H Legal

### Additional Distribution:

G. Kelly, K-H RISS  
J. Lucerna, K-H RISS  
J. Stover, DOE-RFFO  
E. Ethington, CDPHE  
G. Morgan, DOE-RFFO  
JR Marschall, K-H RISS  
J. Cable, K-H RISS

## ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE ER REGULATORY CONTACT RECORD

Date/Time: 6-9-04

Site Contact(s): Annette Primrose Norma Castaneda  
Phone: 303 966-4385 303 966-4226

Regulatory Contact: Dave Kruchek  
Phone: 303 692-3328  
Agency: CDPHE

Purpose of Contact: Removal of Sanitary Sewer west of B371

### Discussion

A portion of the sanitary sewer line that connected B116 to the 371 Trailers will be removed because the dirt in this area will be used as backfill at other site locations, and it is anticipated that the sewer line will no longer be 3 feet or more below grade. The associated manholes and cleanouts will be removed at the same time to ensure that all remaining structures are greater than 3 feet below grade at final grade.

The remaining lines will be plugged and grouted at the open ends, forming a 9 inch to 1 foot grout plug. The excavation will be backfilled to correspond to final grade at this location.

Contact Record Prepared By: Annette Primrose

### Required Distribution:

M. Aguilar, USEPA  
H. Ainscough, CDPHE  
S. Bell, DOE-RFPO  
J. Berardini, K-H  
B. Birk, DOE-RFPO  
L. Brooks, K-H ESS  
L. Butler, K-H RISS  
G. Carnival, K-H RISS  
N. Castaneda, DOE-RFPO  
C. Deck, K-H Legal  
N. Demos, SSOC  
S. Gunderson, CDPHE  
M. Keating, K-H RISS  
G. Kleeman, USEPA  
D. Kruchek, CDPHE  
J. Legare, DOE-RFPO

D. Mayo, K-H RISS  
J. Mead, K-H ESS  
S. Nesta, K-H RISS  
L. Norland, K-H RISS  
K. North, K-H ESS  
E. Pottorff, CDPHE  
A. Primrose, K-H RISS  
R. Schassburger, DOE-RFPO  
S. Serreze, K-H RISS  
D. Shelton, K-H ESS  
C. Spreng, CDPHE  
S. Surovchak, DOE-RFPO  
J. Walstrom, K-H RISS  
K. Wiemelt, K-H RISS  
C. Zahm, K-H Legal

### Additional Distribution:

Gerry Kelly, K-H RISS  
Joe Lucerna, K-H RISS  
Gary Parson, K-H RISS

62

## ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE ER REGULATORY CONTACT RECORD

---

**Date/Time:** June 21, 2004

**Site Contact(s):** Annette Primrose      Norma Castaneda  
**Phone:** 303 966-4385      303 966-4226

**Regulatory Contact:** Dave Kruchek  
**Phone:** 303 692-3328  
**Agency:** CDPHE

---

**Purpose of Contact:** Disposition of Sanitary Sewer at B887

---

### **Discussion**

A sample was collected from the sump in the sewer lift station on the north side of Building 887. This area was previously flushed with a fire hose prior to the start of building demolition, and very little material remained within the sump. The material remaining was barely sufficient for collection of the sample.

The sample was analyzed by gamma spectroscopy with the following results:

Americium 241 – non detect

Uranium 235 – 9.81 pCi/g ( WRW action level is 8 pCi/g for soils)

Uranium 238 – 5.99 pCi/g (WRW action level is 351 pCi/g for soils)

Because of the elevated uranium 235 in the small amount of remaining sediment, the lift station and sump will be removed along with the manhole immediately adjacent to the lift station and the connecting sanitary sewer line. The upgradient portion of the line will be examined where cut, and a sample collected if material is present. Then the remaining line will be plugged and grouted at the open end, forming a 9 inch to 1 foot grout plug. At this time, it is anticipated that no sediment will be present because of the high volume of water used to flush the line.

Recent characterization of IHSS Group 800-5 887 UBC determined that soils in this area were not adversely impacted by material within the sump.

---

**Contact Record Prepared By:** Annette Primrose

---

### Required Distribution:

M. Aguilar, USEPA  
H. Ainscough, CDPHE  
S. Bell, DOE-RFPO  
J. Berardini, K-H  
B. Birk, DOE-RFPO  
L. Brooks, K-H ESS  
L. Butler, K-H RISS  
G. Carnival, K-H RISS

D. Mayo, K-H RISS  
J. Mead, K-H ESS  
S. Nesta, K-H RISS  
L. Norland, K-H RISS  
K. North, K-H ESS  
E. Pottorff, CDPHE  
A. Primrose, K-H RISS  
R. Schassburger, DOE-RFPO

### Additional Distribution:

Mike Swartz, K-H RISS  
Don Clark, K-H RISS  
Dyan Foss, K-H RISS  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

63

N. Castaneda, DOE-RFPO  
C. Deck, K-H Legal  
N. Demos, SSOC  
S. Gunderson, CDPHE  
M. Keating, K-H RISS  
G. Kleeman, USEPA  
D. Kruchek, CDPHE  
J. Legare, DOE-RFPO

S. Serreze, K-H RISS  
D. Shelton, K-H ESS  
C. Spreng, CDPHE  
S. Surovchak, DOE-RFPO  
J. Walstrom, K-H RISS  
K. Wiemelt, K-H RISS  
C. Zahm, K-H Legal

---

---

---

---

---

---

---

---

64



## ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE ER REGULATORY CONTACT RECORD

**Date/Time:** January 13, 2005

**Site Contact(s):** Karen Wiemelt  
**Phone:** 303 966-9883  
K-H RISS

**Regulatory Contact:** David Kruchek  
**Phone:** 303 692-3328  
**Agency:** CDPHE

**Purpose of Contact:** Closure of Sanitary Sewer Lines and System

### **Discussion**

Closure of the sanitary sewer system, lines, manholes and other system components (such as lift stations, tanks, slabs, etc) associated with the Sanitary Sewer System and Sewage Treatment Plant (Building 995 Area) will be documented in the Building 995 Area D&D closeout report. This documentation will include the following items:

- A map, or maps, showing the status (final disposition) of all system wide infrastructure associated with the Sanitary Sewer System (Industrial Area) as well as the Sewage Treatment Plant (B995 Area) including (but not limited to) lift stations, manholes, tanks, slabs, and sewer lines at closure (removed, remaining, grouted, etc.),
- Text describing how sanitary sewer system infrastructure (lines, manholes, tanks, slabs, lift stations, etc) were dispositioned, and
- A discussion of the potential impacts to the environment if, groundwater leaks into or out of the sanitary sewer lines, as well as the efforts implemented to address this and/or prevent this from occurring. This will also include appropriate references to the ER IHSS Group Closeout Report for the Sanitary Sewer System.

**Contact Record Prepared By:** Karen Wiemelt

### Required Distribution:

M. Aguilar, USEPA  
H. Ainscough, CDPHE  
S. Bell, DOE-RFPO  
J. Berardini, K-H  
B. Birk, DOE-RFPO  
L. Brooks, K-H ESS  
L. Butler, K-H RISS  
G. Carnival, K-H RISS  
N. Castaneda, DOE-RFPO  
C. Deck, K-H Legal

D. Mayo, K-H RISS  
J. Mead, K-H ESS  
S. Nesta, K-H RISS  
L. Norland, K-H RISS  
K. North, K-H ESS  
E. Pottorff, CDPHE  
A. Primrose, K-H RISS  
M. Roy, DOE-RFPO  
R. Schassburger, DOE-RFPO  
S. Serreze, K-H RISS

### Additional Distribution:

C. Frieboth, K-H RISS  
R. Caulfield, K-H RISS

65

N. Demos, SSOC  
S. Gunderson, CDPHE  
M. Keating, K-H RISS  
L. Kimmel, USEPA  
D. Kruchek, CDPHE  
J. Legare, DOE-RFPO

D. Shelton, K-H ESS  
C. Spreng, CDPHE  
S. Surovchak, DOE-RFPO  
J. Walstrom, K-H RISS  
K. Wiemelt, K-H RISS  
C. Zahm, K-H Legal

---

---

---

---

---

---